



AC Servo User Manual



QMAELECTRIC (ZHEJIANG) CO.,L

Contents

Chapter1	Product Inspection and Installation.....	01
1.1	Product Inspection.....	01
1.2	Product front FAnel.....	02
1.3	Servo installation method.....	03
Chapter2	Servo Specifications.....	06
2.1	Servo Specifications.....	06
2.2	Servo Named rules.....	07
2.3	Servo Motor Named rules.....	07
2.4	Servo motor and servo driver adaptation table.....	07
Chapter 3	Driver and Motor Dimensions.....	08
3.1	Driver Dimensions.....	08
Chapter 4	Drive System Wiring And Introduction.....	09
4.1	Servo system wiring.....	09
4.2	Servo driver terminals Introduction.....	11
4.3	Main Circuit Terminal.....	12
4.4	CN1 Control Signal Terminal.....	14
4.5	CN2 Encoder Signal Terminal.....	27
4.6	CN3 And CN4 Terminal Definition.....	28
4.7	Anti-jamming Countermeasures of Power Wiring.....	31
Chapter 5	Running Mode And Controlling Wiring.....	35
5.1	Position Control Mode.....	35
5.2	Speed Control Mode	40
5.3	Torque Control Mode.....	43
5.4	Origin Regression Function And Relevant FArameters Introduction... ..	45
5.5	Pre-operational Inspection.....	48
Chapter 6	Operation and Display.....	49
6.1	Drive FAnel Description.....	49
6.2	Main Menu.....	50
6.3	Steps To Set FArameters.....	50
6.4	Status Monitoring.....	51
6.5	Analog Quantity Zeroing Adjustment.....	52
6.6	Restore FArameter default values.....	53
Chapter 7	FArameters.....	54
7.1	FA Group.....	54
7.2	FC Group FArameters For Multifunctional Terminals.....	76
7.3	FD Group FArameters For Internal Position Command.....	85
Chapter 8	Error Code.....	92
Chapter 9	Alarm handling method -	94

Chapter 1 Product Inspection and Installation

1.1 Product inspection: This product has been made a complete functional test before leaving the factory. To prevent any abnormalities caused by negligence during product transportation, please carefully inspect the following items after unFacking:

- Check if the servo driver and servo motor models are the same as the ones you ordered.
- Check whether the servo driver and servo motor are damaged or scratched during transportation. When damage is caused during transportation, do not connect wire or power on.
- Check if there are any loose components between the servo driver and servo motor. If there are any loose screws, or the screws not locked or falling off.
- Check if the servo motor rotor shaft can rotate smoothly by hand. Motors with brakes cannot rotate directly.
- Check if the servo operation manual is included.
- Check if the drive accessories are included in the FAckaging box.

If there are any discreFancies in the product content, please contact the agent.

1.2 Product front FAnel

This FAnel introduces the models: Q300-40, Q300-75

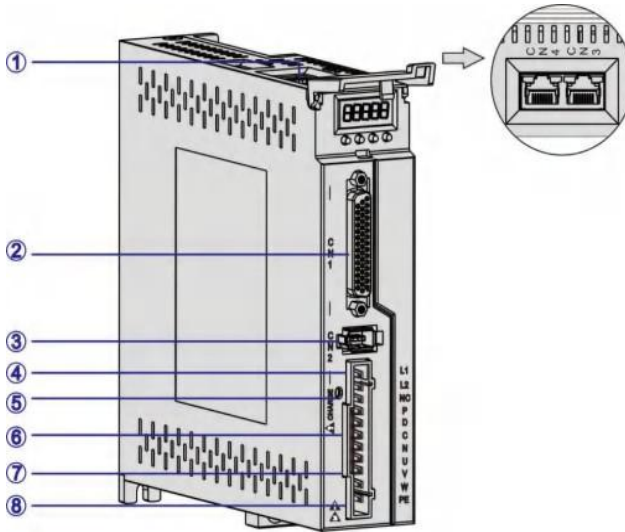


Figure 1.1 Introduction to the Front FAnel of Q300 Servo Driver

Seq	Terminal	Function
①	CN3, CN4	Communication terminal.
②	CN1	Input and output control signal terminals.
③	CN2	Encoder signal terminal, connected to motor encoder.
④	L1,L2	Main power input terminal.
⑤	CHARGE	Bus voltage indicator light. Used to indicate that the bus caFAcitor is in a charged state. When the indicator light is on, even if the main circuit power is turned off, the internal caFAcitor of the servo unit may still have charge. Therefore, do not touch the power terminal when the light is on to avoid electric shock.
⑥	P,D,C,N	Brake resistor connection terminal.
⑦	U,V,W	Servo motor connection terminal. Connect servo motors U, V, and W phases.
⑧	PE	Grounding terminal. Connect to the power supply and motor grounding terminals for grounding treatment.

1.3 Servo installation method

1.3.1

Driver installation

● Installation direction: Normal Servo driver installation direction is vertical and upright.


● Installation and fixation

During installation, tighten the two M4 fixing screws at the rear of the servo driver.

● Be sure to ground the driver grounding terminal, otherwise there may be a risk of electric shock or interference causing incorrect operation.

● Requirements of connect wiring

When wiring the driver, please route the cable downwards (refer to the figure below) to avoid liquid adhering to the cable on site and causing the cable to flow into the driver.

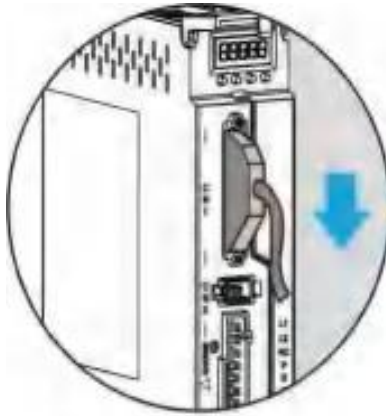

Please wire the connected cables in a downward direction

Figure 1.2 Schematic diagram of servo driver cable routing requirements

● Installation interval

Please refer to Figure 1.3 for the installation sFACING distance between drivers and other devices. Please note that the minimum dimensions are indicated on the figure. To ensure the performance and lifesFAN of the drivers, please leave sufficient installation sFACING as much as possible.

● Cooling servo driver, adopts Free cooling mode and forced cooling mode.

● Installation precautions: When installing the electrical control cabinet, prevent dust or iron filings from entering the interior of the servo drive.

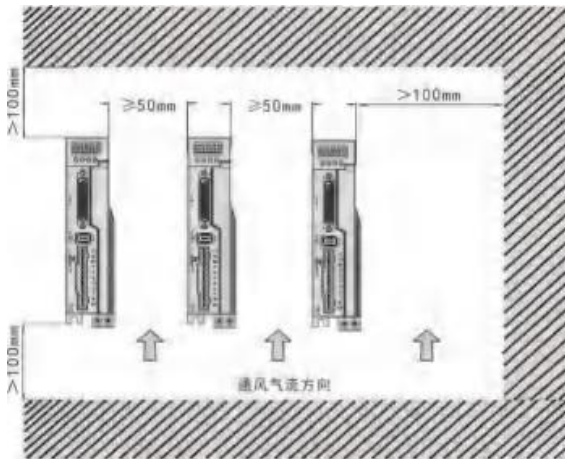


Figure 1.3 Installation Interval

1.3.2 Installing environmental conditions

- | |
|---|
| <ul style="list-style-type: none"> ● Working environment temperature: 0-40 °C; Working environment humidity; Below 80% (without condensation). |
| <ul style="list-style-type: none"> ● Storage environment temperature: -40~50 °C; Storage environment humidity: below 80% (without condensation). |
| <ul style="list-style-type: none"> ● Vibration: below 0.5G. |
| <ul style="list-style-type: none"> ● A well ventilated place with minimal moisture and dust. |
| <ul style="list-style-type: none"> ● No corrosive or igniting gases, oil and gas, cutting fluid, cutting powder, iron powder, etc. |
| <ul style="list-style-type: none"> ● Places without water vapor and direct sunlight. |

1.3.3 Motor installation method

- | |
|--|
| <ul style="list-style-type: none"> ● Horizontal installation: To prevent liquids such as water and oil from flowing into the motor from the outlet, please place the cable outlet below. |
| <ul style="list-style-type: none"> ● Vertical installation: If the motor shaft is installed upwards and a gearbox is attached, attention should be paid to and prevent oil stains inside the gearbox from seeping into the motor through the motor shaft. |
| <ul style="list-style-type: none"> ● The extension of the motor shaft needs to be sufficient, as insufficient extension will easily cause vibration during motor movement. |
| <ul style="list-style-type: none"> ● When installing and disassembling the motor, do not use a hammer to strike the motor, otherwise it may damage the motor shaft and encoder. |

1.3.4 Definition of motor rotation direction

The definition of the motor rotation direction in this manual: facing the motor shaft, the counterclockwise rotation (CCW) of the rotating shaft represents forward rotation, and the clockwise rotation (CW) of the rotating shaft represents reverse rotation.

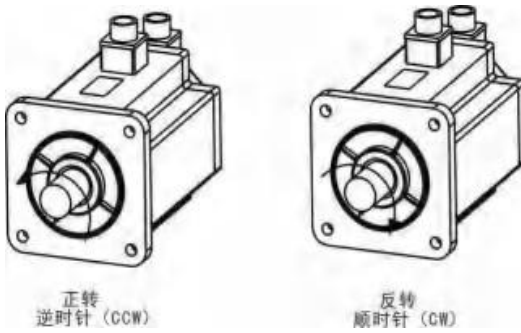


Figure 1.4 Definition of Motor Rotation Direction

Chapter 2 Servo Specifications

2.1 Introduction of servo driver specifications

Model	Q300-40	Q300-75
Output Power	0.05KW~0.4KW	0.75KW~1KW
Main Circuit Input Power Supply	Single phase AC220V-15%~+10%50/60Hz	
Control Mode	0: Position control method; 1: Speed control mode; 2: Torque control method; 3: Hybrid control method for position and speed; 4: Position torque hybrid control method; 5: Speed torque hybrid control method	
Protect Function	Overspeed/main power supply overvoltage/undervoltage/overcurrent/overload/encoder abnormality/control power supply abnormality/position deviation	
Monitor Function	Speed/current position/command pulse accumulation/position deviation/motor torque/motor .current/operating status, etc	
Control Input	1: Servo Enable. 2: Alarm Clear. 3: CCW Drive Inhibit. 4: CW Drive Inhibit. 5: Deviation counter reset. 6: Command pulse inhibit. 7: CCW torque limit. 8: CW torque limit	
Control Output	Servo ready/servo alarm/positioning completed/mechanical braking	
dynamic Braking	Supports both built-in and external	
Applicable Load	Less than 3 times the motor inertia	
Display	5-digit LED Nixie tube display, 4 operation keys	
Communication method	RS485	
Position Control	Input Way	0: Pulse+direction
		1: CCW/CWPulse
		2: A/BTwo-phase orthogonal pulse
		3: Internal position control
	Input Electronic Gear Ratio	Gear ratio molecule: 1-32767
		Gear ratio denominator: 1-32767

2.2 Naming rules for servo drives

Q **300** **H** - **40** - □□□
 ① ② ③ ④ ⑤

Seq	Means
①	Qma Q Series serve Driver
②	Power, 100: 0.05KW~1KW; 200:1KW~2KW;
③	S: Simple servo, suitable for 17 bit absolute encoder
④	Specific power of servo below 1KW, 40:50W~400W;
⑤	Special specifications: customized by customers

Chapter 3 Driver and Motor Dimensions

3.1 Driver Dimension

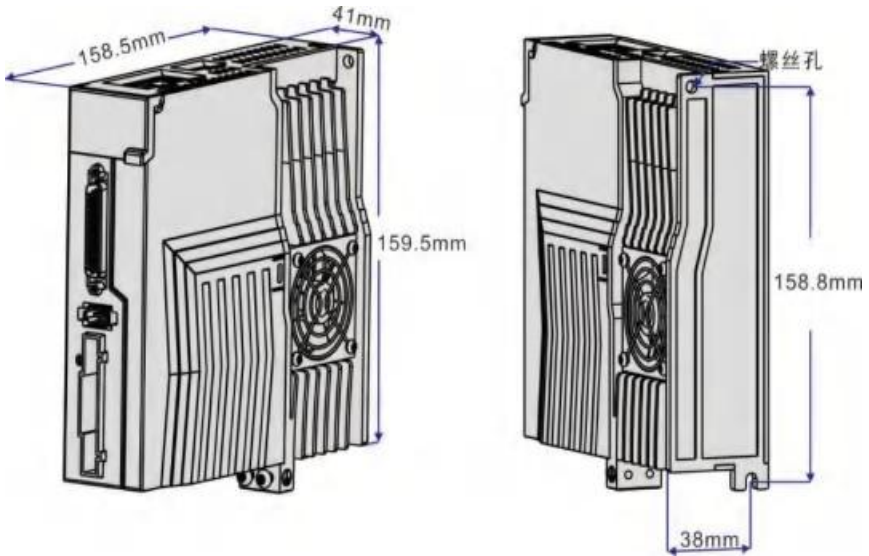


Figure 3.1 Outline Dimensional Drawing of Q300-40/Q300-75 Series



◆ The base of Q300-40 does not with a cooling fan.

Chapter 4 Driver System Wiring and Composition

4.1 Servo system wiring

4.1.1 Servo driver wiring diagram

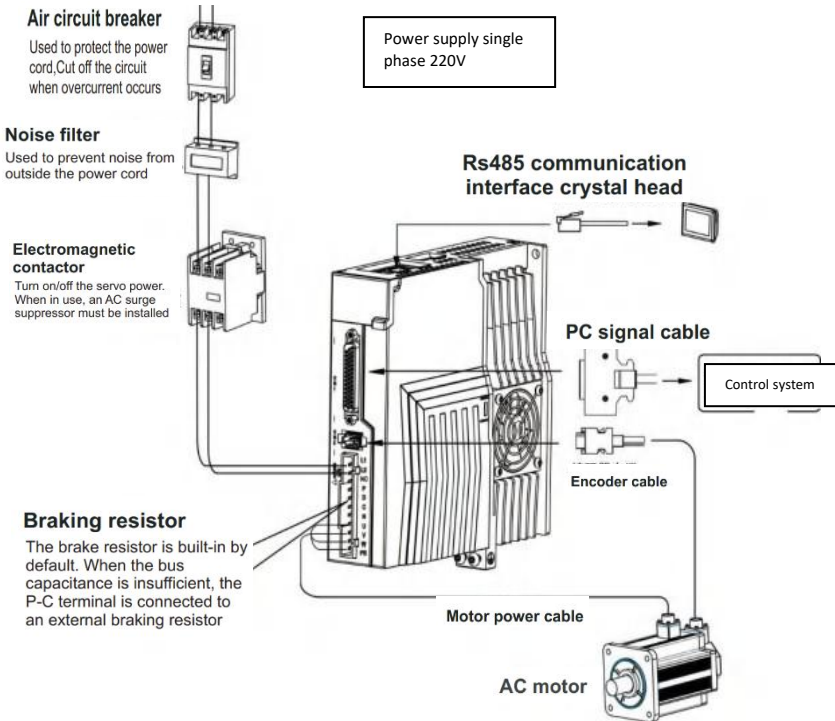


Figure 4.1 Servo System Wiring Diagram

4.1.2Wiring Instructions

Wiring precautions:

The cable length is within 3m of the instruction cable, and the encoder length is within 20m.

Check if the power supply and wiring of L1 and L2 are correct. If only single-phase 220VAC drives are supported, do not connect them to 380VAC power supply.

The phase sequence of the output U, V, and W terminals of the motor must connect to the corresponding terminals of the driver one by one. The motor may not rotate or spin due to incorrect connection. It is not possible to reverse the motor by swapping the three-phase terminals, which is different from asynchronous motors.

The motor grounding terminal must be connected to the servo driver grounding terminal PE and well grounded.

FAy attention to the correct direction of freewheel diode which is connected with the delay at the output terminal, other can cause the output circuit breakdown.


In order to protect the servo driver from noise interference that can cause malfunction, please use an insulation transformer and noise filter on the power lines.

Wiring the power cables(power supply , main circuit ,etc) at a distance over 30cm away from the control signal cables, do not lay them together.

Please install a non fusible circuit breaker to cut off external power in a timely manner when the driver malfunctions.

After the power supply is cut off, wait at least 5 minutes before touching the driver and motor.

4.1.3Wire Spec

Connection terminal	Symbol	Wire Spec
Main Power Supply	L1、L2	1.5~4mm ²
Servo Motor	U、V、W	1.5~4mm ²
Ground		1.5~4mm ²
Control Signals	CN1	≥0.14mm ² (AWG26),Including shielded wire
Encoder Signals	CN2	≥0.14mm ² (AWG26),Including shielded wire
Regenerative Resistors Terminals	P、D/P、C	1.5~4mm ²

- ◆ Must use a twisted FAir wire cable for the encoder signal wiring. If the encoder signal cable is too long(>20m), in which the encoder power supply can be insufficient, may use multi wires or thick wire for the power supply wiring.



4.2 Servo driver terminals Introduction

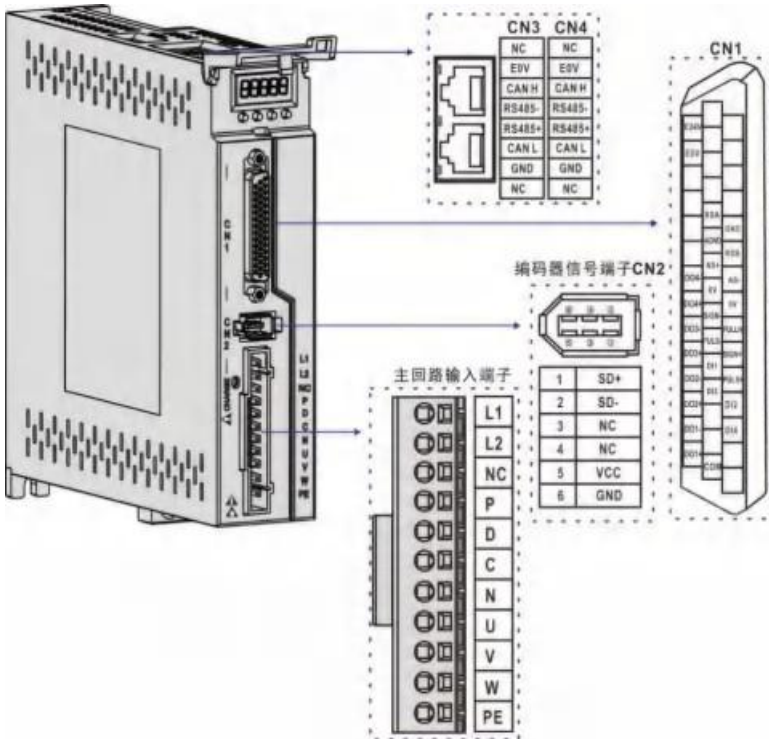


Figure 4.2 Schematic diagram of terminal



- ◆ The above picture shows the pins arrangement of the drive.

4.3 Main Circuit Terminal

4.3.1 Main Circuit Terminal Introduction Figure

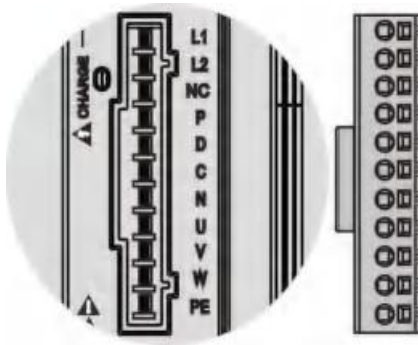


Figure 4.3 Main Circuit Terminal

Name	Terminal Symbols	Detail description
Main Power Supply	L1、L2	Single phase 220VAC -15%~+10%, 50/60Hz
	NC	Not used
Regenerative Resistance	P、D	When use the built-in resistor, please connect P and D.
	P、C	When using an external brake resistor, P is shorted to D, and then the external brake resistor wiring is connected between P and C, respectively. P and N prohibit connections.
Servo Motor	U、V、W	U、V W phase output to servo motor.
	⊕	Ground with servo motor and power supply.



◆The built-in resistor has been set as default by factory: P and D connector are in short-cut condition.

4.3.2 Brake resistance wiring instructions

If the internal brake resistor is used, the driver is shorted to P and D, that is, it can be used normally according to the factory state, as shown in Figure A. If an external brake resistor is used, the short connection between P and D must be disassembled and then crossed to P and C, as shown in Figure B:

FigureA

FigureB

Precautions for braking resistor wiring:

- ◆ Do not connect the external brake resistance to the positive and negative poles of the bus P、N, otherwise it will cause explosion and fire.
- ◆ Must be over minimum resistance value at 25Ω. Otherwise it would cause drive alarm or damage.
- ◆ Please install external brake resistance on non-combustible materials such as metal.



4.4 CN1 Control signal terminals

4.4.1 CN1 Terminal Introduction

The CN1 signal connector with DB44 plug provides the signals interfaced with the host controller.. The signal includes:

- 4 programmable input terminals
- 4 programmable output terminals;
- Analog command inputs;
- Pulse command inputs.

4.4.2 CN1 terminal pin distribution


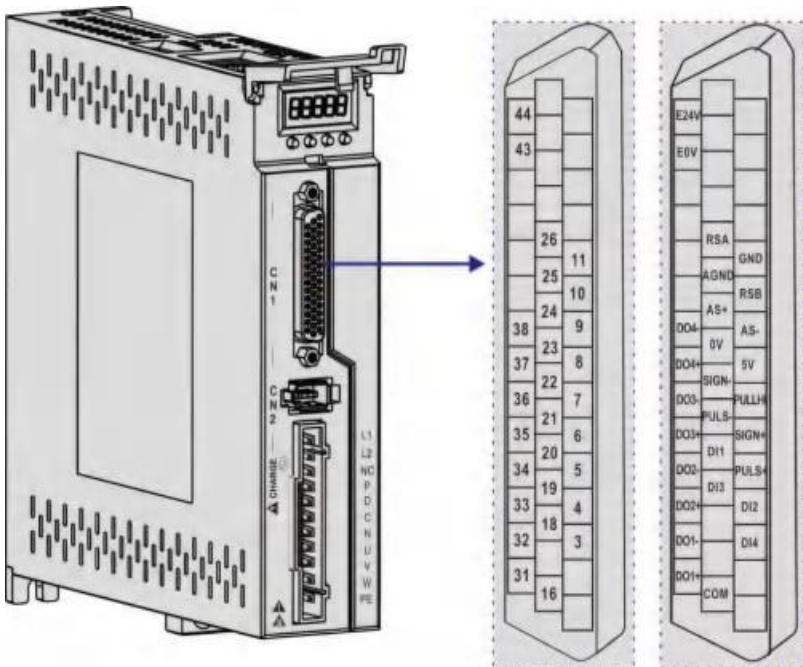


Figure 4.4 CN1 Terminal Pin Distribution



◆ 24-26 AWG cable is recommended.

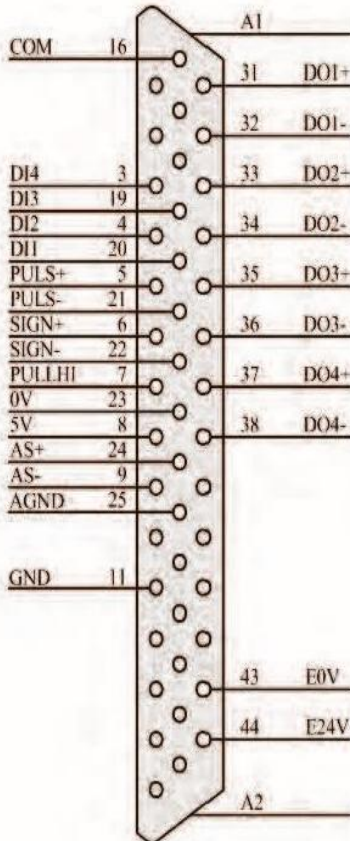

Pin	NAME	Function
16	COM	Digital input signal common
3	DI4	Digital input 4
19	DI3	Digital input 3
4	DI2	Digital input 2
20	DI1	Digital input 1
5	PULS+	Command pulse input
21	PULS-	
6	SIGN+	Addition of command pulse
22	SIGN-	
7	PULLHI	24V power input interface
23	0V	
8	5V	Internal 5V power output
24	AS+	Analog speed/torque command input
9	AS-	
25	AGND	Analog signal ground
11	GND	Internal digital signal
31	DO1+	Digital output 1
32	DO1-	
33	DO2+	Digital output 2
34	DO2-	
35	DO3+	Digital output 3
36	DO3-	
37	DO4+	Digital output 4
38	DO4-	
43	E0V	Internally isolated 24V power output
44	E24V	
A1	Metal shell grounding	
A2		

Figure 4.5 Schematic diagram of the driver CN1 terminal pin

4.4.3 Position Instruction Input Signal

Signal name		Pin No#	Function
Position pulse instruction	PULS+	5	High-speed photoelectric isolation input, FArparameter FA14 setting working mode:
	PULS-	21	
	SIGN+	6	Pulse + direction; CCW/CW pulse;
	SIGN-	22	A, B two-phase orthogonal pulse input; Internal position control input.
	PULLHI	7	External 24V power input interface of the instruction pulse.
	GND	11	Internal digital signal ground.

The command pulse output circuit on the host device side can be selected from two types of differential driver output or open collector output. The maximum input frequency and minimum pulse width are shown in the following table:


Pulse mode	Maximum frequency	Minimum pulse width
Difference output	500k	1
Open collector	200k	2.5

- ◆ If the output pulse width of the upper device is less than the minimum pulse width value, the driver will receive the pulse incorrectly.
- ◆ The ports between PULS plus and PULS-and between SIGN and SIGNAL only support signal level inputs below 5V, and more than 5V signals must be threaded with external resistors or the driver will be damaged.



Schematic diagram of the pulse command input circuit


1) In differential mode

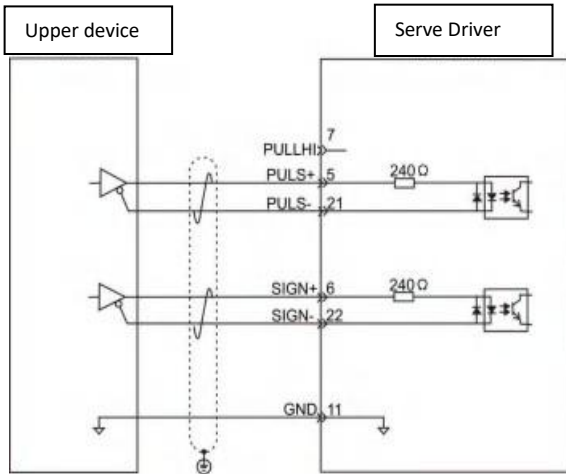


2) In collector open mode

A) When using the Servo drive's internal 24V power supply:

Common anode connection method, such as: Mitsubishi PLC.

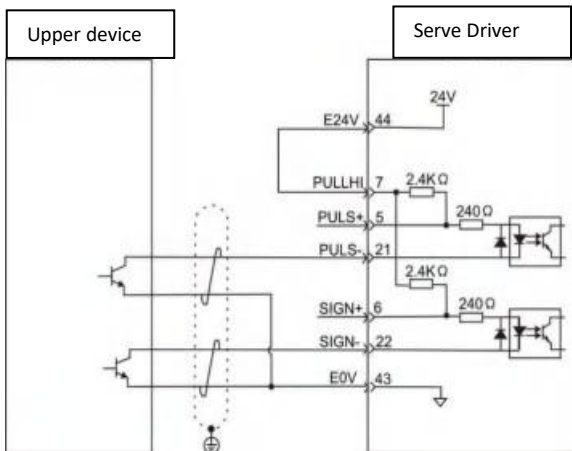


Common cathode connection method: For example: Siemens PLC

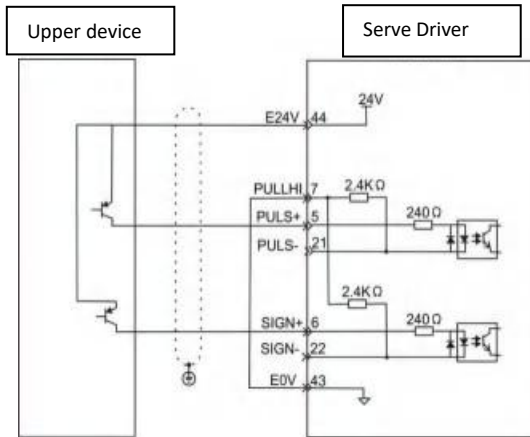


B) Use external power supply:

Case1: Use the drive internal resistance (recommended)

Common anode connection

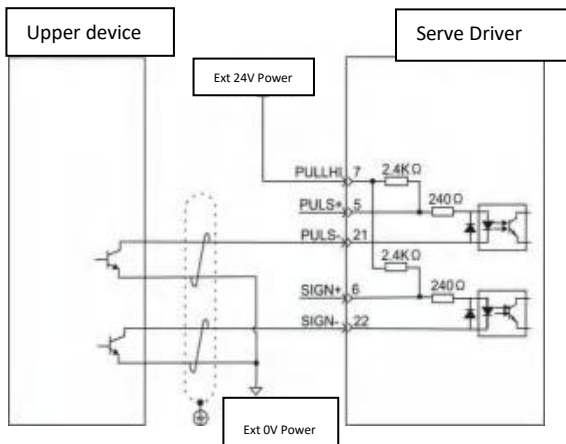


Common cathode connection

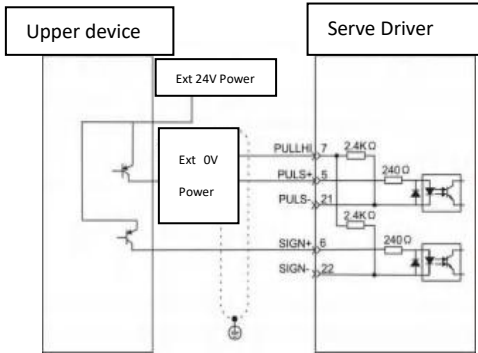


Case2: Use the driver's external resistance

Common anode connection :

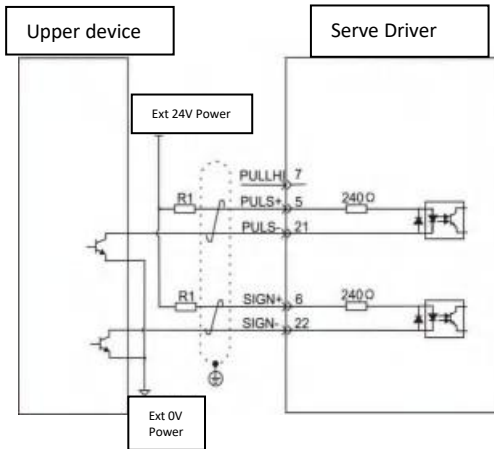

Common cathode connection :

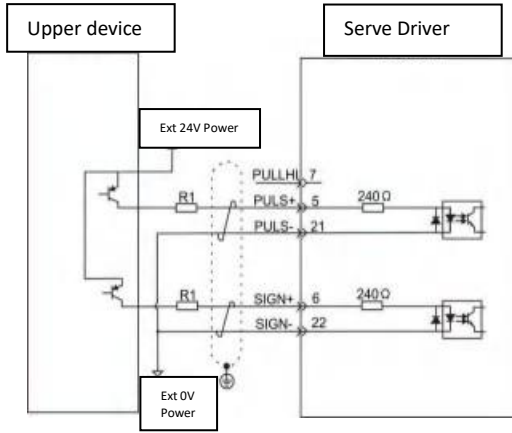

◆ Selection formula for resistance R1::

$$VCC-1.5$$

$$R1=240=10m$$

Sheet 4-1recommend R1value

VCCVoltage	R1Value	R1Power
24V	2.4KΩ	0.5W
12V	1.5KΩ	0.5W



4.4.4 Digital Quantity Input And Output Signal

Signal	Pin	Def Function	Instruction
Digital input	DI1	20	Servo enablement
	DI2	4	Alarm cleared
	DI3	19	Forward drive prohibited
	DI4	3	Reverse drive prohibited
	PULS-	21	In position mode (internal position)
			Optoelectronic isolation input and function can be programmable. Defined by FParameter FC group(FC-0~FC-17). The input voltage of COM is both of common positive and negative terminal. And input signal voltage is 12~24V. In position mode (internal position mode) and non-position mode ,please connect 24 V to pin 7,


Signal		Pin	Def Function	Instruction
	SIGN-	22	mode) and non-position mode	DI5 to pin21, DI6 to pin 22. Or to connect 0 V to pin7, DI5 to 5 pin ,DI6 to pin 6.
	PULS+	5		
	SIGN+	6		
	PULLHI	7		
	COM	16	Common end of digital input signals	
Digit output	DO1+	31	Z signal output	Photo isolation output. Function can be programmable. Defined by FArparameter FC group (FC-20~FC-23). Remark: When FA104=1, the differential output can be programed by FC-24.
	DO1-	32		
	DO2+	33	Alarm output	
	DO2-	34		
	DO3+	35	Position completed	
	DO3-	36		
	DO4+	37	Magnetic brake	
	DO4-	38		
	DO5+/ RSA	26	Signal differential output	
	DO5-/ RSB	10		
Internal power output	0V	23	Internal 0V	Internal 5V supply output with 200mA maximum output current.
	5V	8	Internal 5V	
Internal isolation Power output	E0V	43	Internal 0V	Internal isolated 24V power output and the voltage range is 20V~28V and max output current 100mA.
	E24V	44	Internal 24V	

Schematic diagram of digital input circuit


For DI1 as an example (the DI1~DI4 interface circuit is the same):

1) When the upper device is relay output:

A) When using the Servo drive's internal 24V power supply:


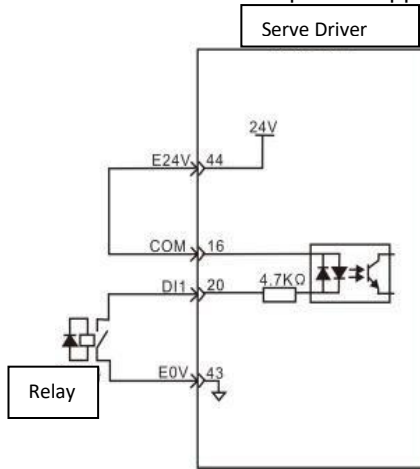


B) When using external 24V power supply:


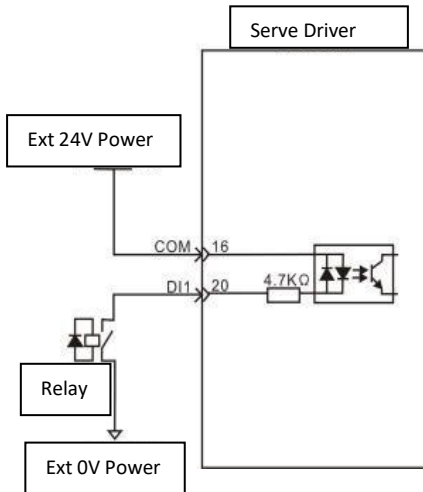


2) When the upper unit is an open output of the collector.

A) When using the internal 24V power supply of the servo drive:

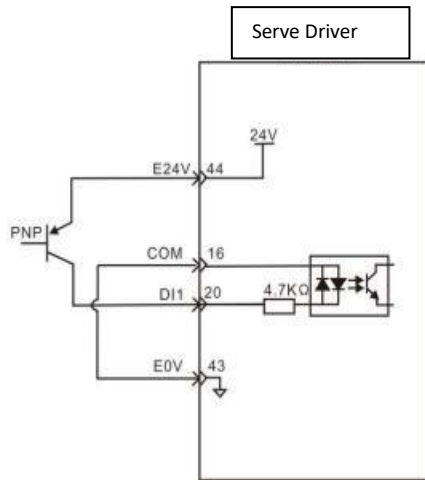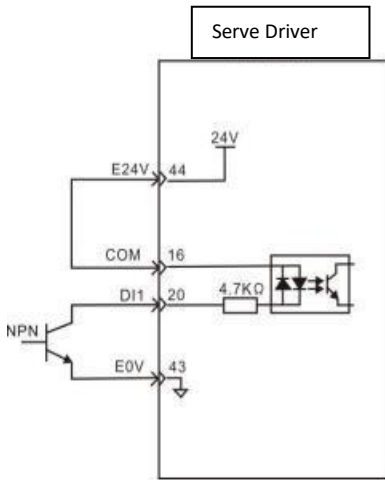

B) When using external 24V power supply:

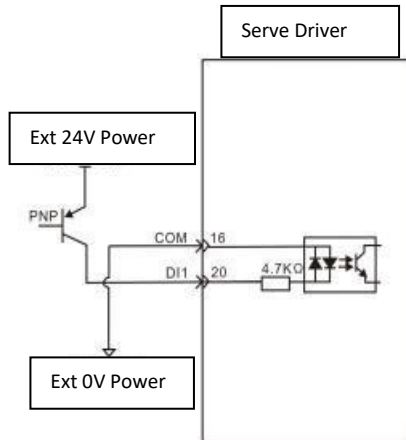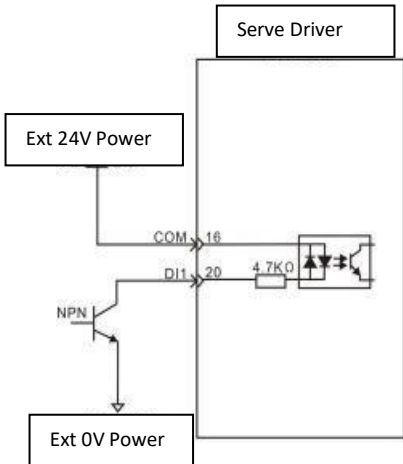


◆ Mixing PNP with NPN input is not supported.


Digital output circuit diagram

Take DO1 as an example, the DO1-DO4 interface circuit is the same.

1) When the upper unit is a relay input:

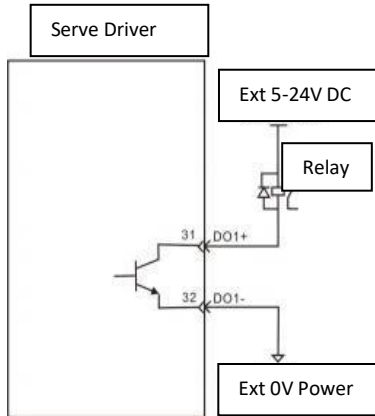

2) When the upper device is an optocoupler input:

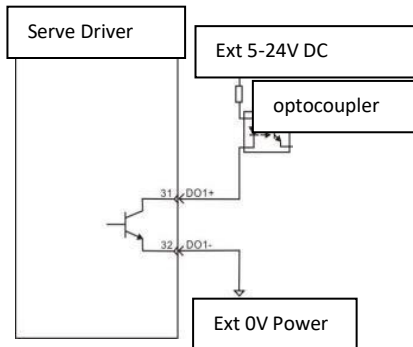

- ◆ When the upper device is a relay, be sure to connect the freewheeling diode, otherwise it may damage the DO port or cause strong signal interference. The maximum allowable voltage and current capacity of the optocoupler output circuit inside the servo drive are as follows:

- Voltage: DC30V
- Current: DC50mA



4.4.5 Analog instruction signal

Signal name		Pin	Function
Analog Instruction Input	AS+、AT+	24	Analog velocity/torque input, range: -10V~+10V
	AS-、AT-	9	
	AGND	25	

Pulse Instruction Input Interface Diagram

There are two kinds of connections, differential input and single-ended input, and differential input join is recommended. Speed and torque share an analog input, input range: -10V to 10V, input impedance of about 10K. It is normal for analog inputs to have zero bias and can be compensated by FParameters.

1) When it is analog differential input:



2) When it is analog single-end input:



4.4.6 Motor Brake Connection

The lock is a mechanism that prevents the servo motor shaft from moving while the servo drive is not running, keeping the motor locked in position so that the moving part of the machine does not move due to self-weight or external forces.

Brake Signal Circuit Diagram

The connection of the lock terminal input signal is not polar and requires the user to provide a 24V power supply. The standard wire examples of the lock signal BK and the lock power supply are as follows:

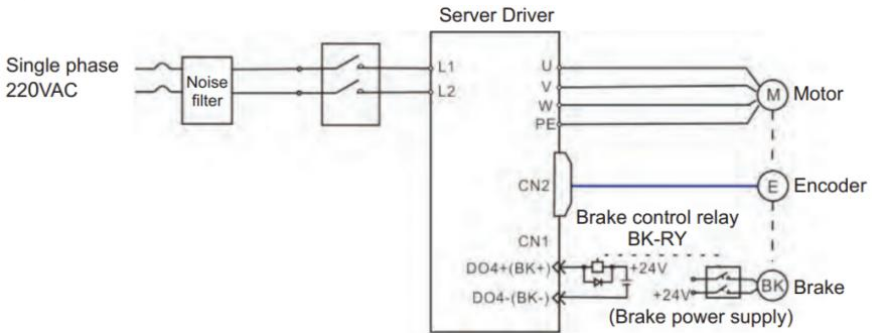


Figure 4.6 Brake Signal Connection

NOTE:

- ◆ lock mechanism built into the servo motor is a fixed special mechanism of nonenergized action type and is not used for braking purposes and only when the servo motor is kept stopped.
- ◆ The lock coil is non-polar
- ◆ After the servo motor is stopped, the servo on signal (Servo On) should be cut off.
- ◆ When the motor with the built-in lock is running, the lock may click without functional effect.
- ◆ Flux leakage may occur at the shaft end and other areas when the lock coil is energized (the lock is open). Be aware when using instruments such as magnetic sensors in motor accessories
- ◆ The lock is prohibited from sharing power supply with other electrical appliances to prevent voltage or current reduction due to the work of other electrical appliances, which ultimately causes the wrong action of the lock
- ◆ Cables above 0.5mm are recommended.



4.5 CN2 Encoder Signal Terminal CN2

4.5.1 CN2 Terminal Introduction

The encoder signal connector CN2 connects with the servo motor encoder. A 6 pins plug is used. The pin chart is:

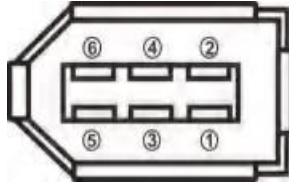


Figure 4.7 CN2 Encoder Signal Terminal

4.5.2 CN2 Signal Introduction

Signal name		Pin No#	Function	
Encoder signal power supply	5V	5	Encoder with a 5V power supply (provided by the driver), cables above 20m, in order to prevent the encoder voltage reduction, the power supply and ground wire can be multi-wire connection or use thick wires	
	0V	6		
Absolute communication terminal	encoder positive	SD+	1	Absolute encoder communication positive terminal
Absolute communication terminal	encoder negative	SD-	2	Absolute encoder communication negative terminal
Empty end		NC	3	Not used
Empty end		NC	4	Not used
Shielded layer		Metal cover		Connect to the shielded layer of the encoder cable

4.6 CN3 And CN4 Terminal Definition

4.6.1 Communication Terminal Wiring Diagram

CN2 encoder signal terminal and motor encoder connection diagram. The terminals of the encoder use a 6PIN socket with a pin distribution of:

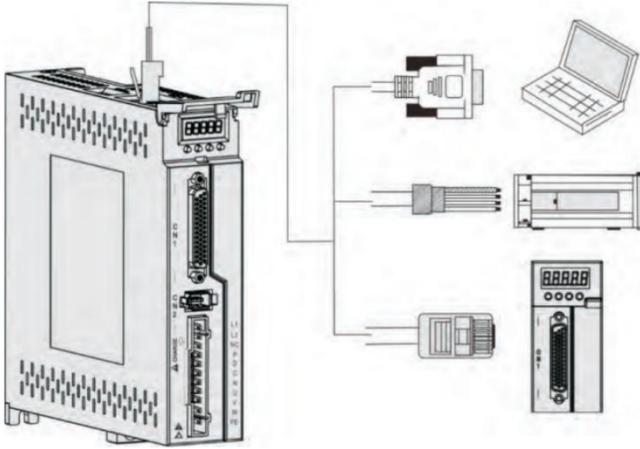


Figure 4.8 Communication Terminal Wiring

4.6.2 Communication port definition

The CN3 and CN4 ports on the drive allow the drive to communicate with the PC, PLC, and drive, where the port pins for CN3 and CN4 are defined as follows:

Pin No.	CN3	name	CN4	name	pic
1	NC	Empty end	NC	Empty end	
2	E0V	CAN signal ground	E0V	CAN signal ground	
3	CANH	CAN bus interface	CAN H	CAN bus interface	
4	RS485-	RS485 Communication interface	RS485 -	RS485 Communications interface	
5	RS485+		RS485+		
6	CANL	CAN bus interface	CANL	CAN bus interface	
7	GND	485 signal ground	GND	485 signal ground	
8	NC	Empty end	NC	Empty end	

NOTE:

- ◆The PC or upper computer controls can be connected via a dedicated serial cable, which is not plugged in and out.
- ◆Twisted FAir or shielded wire is recommended, the length of the wire is less than 2 meters.
- ◆When multi-machine series, the CN3 is connected to the first-stage drive CN4 and the CN4 is connected to the first-stage driveN3.
- ◆When using RS485 bus communication, when the upper machine's 485 signal is connected to the earth (PE), connect the upper machine PE terminal to the driver terminal by reasonable grounding, in which case the upper machine 485 signal ground is not allowed to be connected to the driver 485 signal ground (GND), otherwise the driver may be damaged.



4.6.3 RS485 Communication Connection Introduction

1. Connection With RS485 of A PLC

A connection cable between the driver and the PLC is as follows:



Figure 4.9 The Communication Cable Of Servo Drive With PLC

Table 4-2 Servo drive and PLC communication cable pin connection relationship

Drive side RJ45 (A-side)		PLC side (B-side)	
Signal name	Pin No#	Signal name	Pin name
RS485+	5	RS485+	5
RS485-	4	RS485-	4
GND	7	GND	7
PE (Shielding layer)	Cover	PE (Shielding layer)	cover

2. RS485 Communication FArallel Connection Of Multi Drives

When using 485 communication network, the FArallel connection of multi drives is as follows:

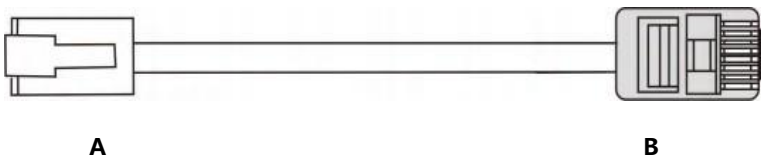


Figure 4.10 FArallel Cable Diagram Of Multi Drives

Table 4-3 Connection Between Multi Drives

Drive side RJ45 (A-side)		PLC side (B-side)	
Signal name	Pin No#	Signal name	Pin name
RS485+	5	RS485+	5
RS485-	4	RS485-	4
GND	7	GND	7
PE (Shielding layer)	Cover	PE (Shielding layer)	cover

3. RS485 Communication Grounding Precaution

When using RS485 communication, the GND terminal of the upper device is connected with the GND terminal of the servo drive as shown in the following picture:

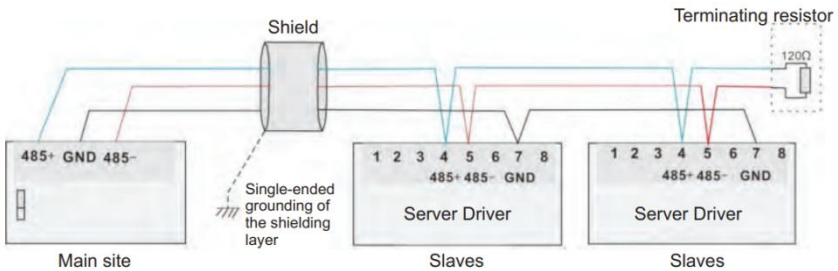


Figure 4.11 485 Communication Connection Diagram

When using RS485 communication, the signal ground of the upper device is connected to the ground as shown in the figure below:

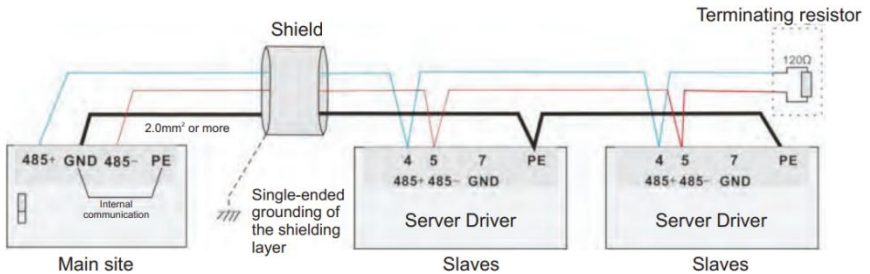


Figure 4.12 485 host computer communication connection diagram

NOTE:

- ◆ The PLC has a built-in 485 communication terminal resistor.
- ◆ It is recommended that the shield be single-ended grounding.
- ◆ Do not connect the GND terminal of the upper unit to the Servo driver E0V terminal, as this will damage the machine



4.7 Anti-jamming countermeasures for power wiring

To suppress interference, please take the following measures:

The instruction input cable length should be below 3m and the encoder cable should be below 20m

Use thick wiring whenever possible for ground wiring. (2.0mm² or more)

Use a noise filter to prevent RF interference. When used in civilian environments or in environments with high power interference, install a noise filter on the input side of the power cord.

To prevent incorrect actions caused by electromagnetic interference, the following methods can be used:

1. Install the upper unit and the noise filter near the servo drive whenever possible.
2. Install the surge suppressor on the coils of relays, solenoids, and electromagnetic contactors.
3. SeFARate the strong line from the weak line when wiring and maintain a distance of more than 30cm. Do not put in the same pipe or tie them together.
4. Do not share power supplies with welding machines, discharge processing devices, etc. When a high frequency generator is nearby, install a noise filter on the input side of the power cord.

4.7.1 Wiring Examples Of Anti-Jamming And Ground Handling

4.7.1.1 Examples of anti-jamming wiring

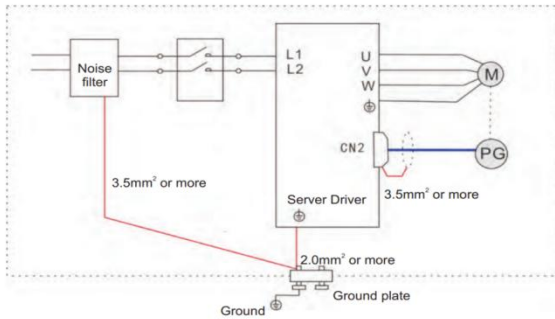


Figure 4.12 Example Of Anti-Jamming Wiring



- ◆ The outer box cable for grounding uses more than 3.5mm² thick wire whenever possible, and braided copper wire is recommended.
- ◆ When using the noise filter, observe the precautions described in the Noise Filter Usage Methods below.

2. Ground handling

To avoid possible electromagnetic interference problems, please ground it as follows.

1) Grounding of the servo motor housing

Please connect the grounding terminal of the servo motor and the grounding terminal PE of the servo drive together, and connect the PE terminal to the ground reliably to reduce potential electromagnetic interference problems.

2) The shielding layer of the encoder cable is grounded Please ground both ends of the shielding layer of the motor encoder cable.

4.7.2 How To Use A Noise Filter

To prevent interference from the power cord and to reduce the imFAct of servo drivers on other sensitive devices, select the appropriate noise filter at the power input, depending on the size of the input current. Also, install the noise filter at the power cord of the peripheral unit as needed. When installing and wiring noise filters, observe the following precautions so as not to imFAir the actual use of the filter.

Please seFArate the noise filter input and output wiring, do not put the two in the same pipe or bundle them together.

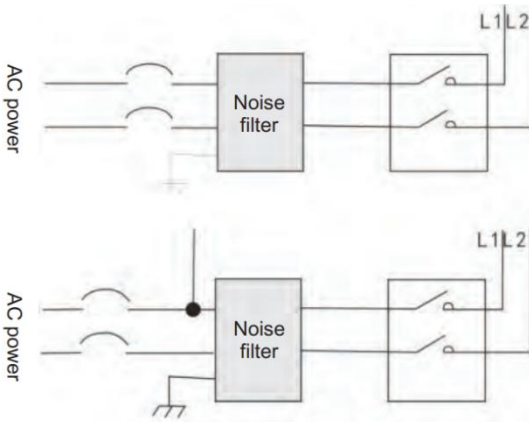


Figure 4.13 Example diagram of separate wiring of noise filter input and output wiring

SeFArate the ground wire of the noise filter from its output power wire

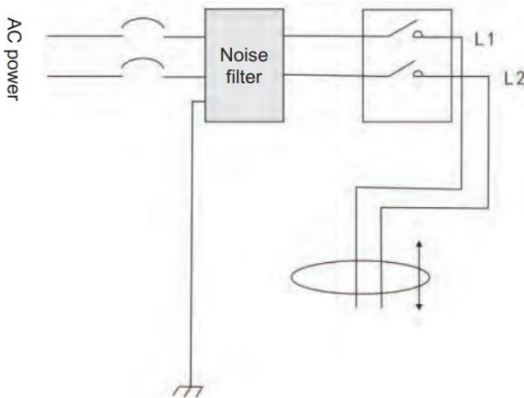


Figure 4.14 Schematic diagram of separate wiring of noise filter ground wire and output wiring

Noise filters should be grounded seFArately using as short a thick wire as possible, and do not share a ground wire with other grounding equipment.

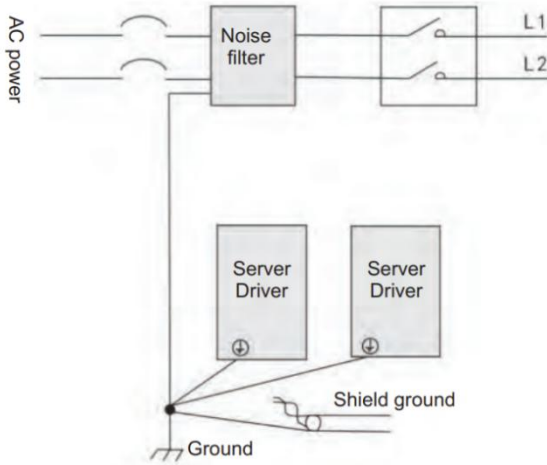


Figure 4.15 Schematic diagram of single point grounding

Ground wire treatment of the noise filter installed in the control cabinet. When the noise filter is installed in the same control cabinet as the servo driver, it is recommended that the filter be secured to the servo drive on the same metal plate to ensure that the contact FArt is conductive and well connected, and that the metal plate is grounded.

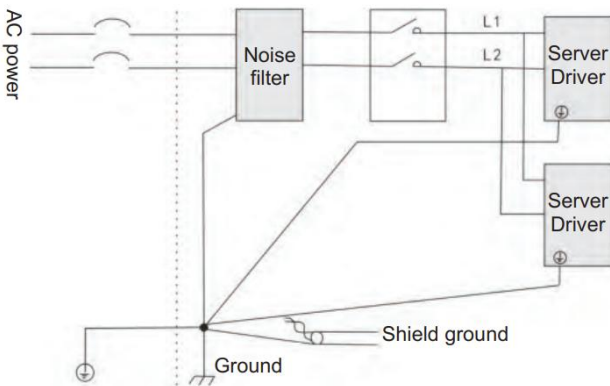


Figure 4.16 Noise filter ground processing schematic

Chapter 5 Running Mode and ControlWiring Chart

Accordingtothecommandmodeandoperationcharacteristicsofservodrive,therearethreemodesofoperation:positioncontroloperationmode,speedcontroloperationmodeandtorquecontroloperationmode.

Position control mode generally determines the displacement of movement by the number of pulses, and the pulse frequency of the external input determines the size of the rotation speed. Because the position mode can be strictly controlled for position and speed, it is generally used in positioning devices. Servo is the most widely used control mode, mainly used in robots, FATCH machines, milling engraving, CNC machine tools.

Speed control mode is used in some constant speed situations by simulating a given amount, a digital quantity given, and communicating a given control rotation speed. For example, the milling machine application, the upper machine uses the position control mode, the servo driver adopts the speed control mode.

The torque control mode is given by analog quantity, given by digital quantity, and by communication given by controlling torque size. Mainly used in the material force has strict requirements for winding and rolling devices, such as winding devices or pull fiber optic equipment and other tension control situations, torque settings should be changed at any time according to the radius of winding, to ensure that the material's force does not change with the winding radius.

5.1 Position control mode

5.1.1 Position Mode Introduction

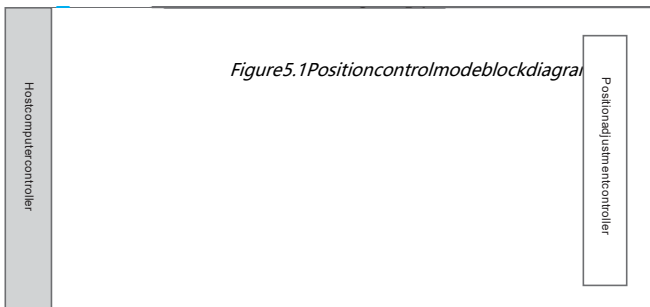


Figure 5.1 Position control mode block diagram

Location mode is a common operating mode for servo drives, and its main use steps are as follows:

- 1) Correctly connect the power supply of the servo main circuit and control

circuit, as well as the motor power line and encoder line. After power-on, the servo fan displays "r0", which means that the servo power supply and encoder wiring are correct.

- 2) Carry out servo JOG test run by pressing the key to confirm whether the motor can run normally.
- 3) Refer to Figure 5.2 for wiring instructions to connect the pulse direction input and pulse command input in the CN1 terminal, as well as the required DI/DO signals, such as servo enable, alarm clear, positioning completion signal, etc.
- 4) Carry out position mode related settings. Set the DI/DO used according to the actual situation.
- 5) Servo enable, control the rotation of the servo motor through the position command issued by the upper computer. First, make the motor rotate at a low speed, and confirm whether the direction of rotation and the electronic gear ratio are normal, and then adjust the gain.

5.1.2 Position mode wiring

Figure 5.2 Position mode wiring diagram

◆ The internal supply voltage range is 20V to 28V, with a maximum operating current of 100mA. If you are using an external 24V power supply, connect the external power supply to pin 16 (COM) and the external power supply 0V to pin 43 (E0V).

◆ DO output power users need to bring their own, power range 5V to 24V. The DO port has a maximum allowable voltage dc30V and a maximum allowable current of 50mA.



5.1.3 FArparameterSettingsInPositionMode

5.1.3.1 GainAndSmoothFilter

Necessary FArparameters	FArparameter Description	FArparameter value	Factory default
FA4	Control method selection	0	0
FA9	Position proportional gain	1-1000	80
FA19	Position command smoothing filter	0-1000×0.1ms	100
FA100	Command filter selection	0-1	0

5.1.3.2 DigitalInput

Necessary FArparameters	FArparameter Description	FArparameter value	Factory default
FA11	Command pulses for each rotation	0-30000	10000
FA12	1st numerator of electronic gear for position command pulse	1-32767	0
FA13	Denominator of electronic gear for position command pulse	1-32767	10000
FA14	Input mode of position command pulse	0-3	0
FA15	reverse direction of position command pulse	0-1	0
FA59	The effective edge of commandpulse	0-1	0
FA77	2nd numerator of electronic gear for position pulse	1-32767	0
FA78	3rd numerator of electronic gear for position pulse	1-32767	0
FA79	4th numerator of electronic gearfor position pulse	1-32767	0
FA80	Effective level of commanddirection signal	0-1	0
FA81	Command pulse(PULS)signal filter	0-15	4
FA82	Command pulse(SIGN)signal filter	0-15	4

5.1.3.3 DigitalOutput(DO)

Necessary FParameters	FParameter Description	FParameter value	Factory default
FA16	Range of positioning completion	0-3000 pulses	10000
FA17	Position deviation limit	0-30000×100 pulses	0
FA18	Position deviation error	0-1	10000
FA83	CWL,CCWL prohibitedmode	0-1	0
FA84	Hysteresis for position completion	0-32767	0
FA85	Range for approach positioning	0-32767	0
FA86	Hysteresis for approach positioning	0-32767	0

5.1.3.4 InputAndOutputTerminals

Necessary FParameters	FParameter Description	FParameter value	Factory default
FA55	Input terminal effective levelcontrol word	0000-1111	0000
FA57	Output terminal effective levelcontrol word	0000-1111	0000
FA58	IO input terminal debounce time constant	1-20ms	2
FC-0	Digital input DI1 function	0-99	1
FC-1	Digital input DI2 function	0-99	2
FC-2	Digital input DI3 function	0-99	3
FC-3	Digital input DI4 function	0-99	4
FC-15	Digital input DI forced effective1	00000000-11111111	00000000
FC-16	Digital input DI forced effective2	00000000-11111111	00000000
FC-17	Digital input DI forced effective3	00000000-11111111	00000000
FC-20	Digital output DO1 function	0-99	2
FC-21	Digital output DO2 function	0-99	3
FC-22	Digital output DO3 function	0-99	5
FC-23	Digital output DO4 function	0-99	8

PositionCommandIntroductionOfInternalPositionPrMode

ThePrpositioncommandsourceisasetof8built-inlocationcommandregisters usingFParameters(FD-2,FD-3)-(FD-23,FD-24),withexternal/O(CN1,POS0-POS2,andCTRG)thatcanselectoneofeightgroupsaslocationcommands:

Name	POS2	POS1	POS0	CTRG	FParameter	Induction	Moving Speed Register
P1	0	0	0	↑	FD-2	Circle(+/-30000)	FD-4 (V1)
					FD-3	Pulse(+/-max cnt)	
P2	0	0	1	↑	FD-5	Circle(+/-30000)	FD-7 (V2)
					FD-6	Pulse(+/-max cnt)	
FC	0	1	0	↑	FD-8	Circle(+/-30000)	FD-10 (V3)
					FD-9	Pulse(+/-max cnt)	
FD	0	1	1	↑	FD-11	Circle(+/-30000)	FD-13 (V4)
					FD-12	Pulse(+/-max cnt)	
P5	1	0	0	↑	FD-14	Circle(+/-30000)	FD-16 (V5)
					FD-15	Pulse(+/-max cnt)	
P6	1	0	1	↑	FD-17	Circle(+/-30000)	FD-19 (V6)
					FD-18	Pulse(+/-max cnt)	
P7	1	1	0	↑	FD-20	Circle(+/-30000)	FD-22 (V7)
					FD-21	Pulse(+/-max cnt)	
P8	1	1	1	↑	FD-23	Circle(+/-30000)	FD-25 (V8)
					FD-24	Pulse(+/-max cnt)	

Absolute

Incremental



5.2 Speed Control Mode Wiring

5.2.1 Introduction

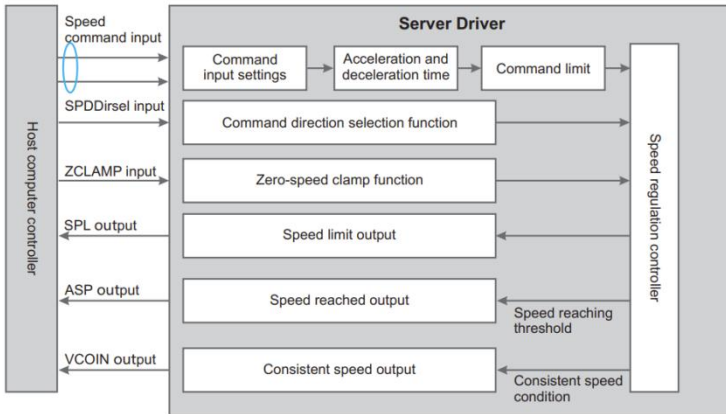


Figure 5.3 Speed Control Mode

The main steps for using speed mode are as follows:

- 1) Properly connect the power supply of the servo main circuit and the control circuit, as well as the motor power cord and encoder line, the servo FAnel displays "r 0" after powering on, which means that the servo power supply and encoder wiring is correct.
- 2) The servo JOG test run is carried out by pressing the button to confirm the normal operation of the motor.

- 3) Refer to Figure 5.4 wiring to explain the required DI/DO signals in the connection CN1 terminal, such as servo enablement, alarm clearing, positioning completion signal, etc.
- 4) Set the speed mode. Set the DI/DO used based on the actual situation.
- 5) Servo enable, through the upper machine issued position command to control the rotation of the servo motor. First rotate the motor at low speed and confirm that the rotation direction and electronic gear ratio are correct, and then make a gain adjustment.

5.2.2 Speed Mode Wiring

Figure5.4Speedmodewiringdiagram

5.2.3 FArparameterSettingsInSpeedMode

RelatedFAparameterstobeadjustedforspeedcontrolmode

Necessary FAra	Description	value	Default
FA4	Control method selection	1	0
FA5	Speed proportional gain	5-2000Hz	150
FA6	Speed integral constant	1-1000ms	75
FA22	Internal and external speed command selection	0-5	0
FA24	Internal speed 1	-6000-6000r/min	100
FA25	Internal speed 2	-6000-6000r/min	500
FA26	Internal speed 3	-6000-6000r/min	1000
FA27	Internal speed 4	-6000-6000r/min	2000
FA28	Arrival speed	0-3000r/min	3000
FA40	Acceleration time constant	1-10000ms	100
FA41	Deceleration time constant	1-10000ms	100
FA42	Stype acceleration and deceleration time constant	0-1000ms	0
FA43	Analog speed command input gain	10-3000r/min/v	300
FA44	The direction of the analog speed command is reversed	0-1	0
FA45	Analog speed command zero offset compensation	-5000-5000	0
FA46	Analog speed command filter	1-300Hz	300
FA75	Zero speed detection point	0-1000r/min	10
FA76	Speed consistent setting value	0-1000r/min	10
FA87	Arrival speed difference	0-5000r/min	30
FA88	Polarity of arrival speed	0-1	0
FA92	Zero speed detection hysteresis	0-1000r/min	5

5.3 Torque control mode

5.3.1 Introduction



Figure 5.5 Torque Control Mode Block diagram

The main steps of using torque mode are as follows:

Correctly connect the power supply of the servo main circuit and control circuit, as well as the motor power line and encoder line. After power-on, the servo FA neld displays "r0", which means that the servo power supply and encoder wiring are correct.

Carry out servo JOG test run by pressing the key to confirm whether the motor can run normally.

Refer to Figure 5.6 for wiring instructions to connect the required DI/DO signals in the CN1 terminal, such as servo enable, alarm clear, positioning completion signal, etc.

Make relevant settings for torque mode. Set the DI/DO used according to the actual situation.

Servo enable, control the rotation of the servo motor through the position command issued by the upper computer. First, make the motor rotate at a low speed, and confirm whether the direction of rotation and the electronic gear ratio are normal, and then adjust the gain.

5.3.2 Torque modewiring

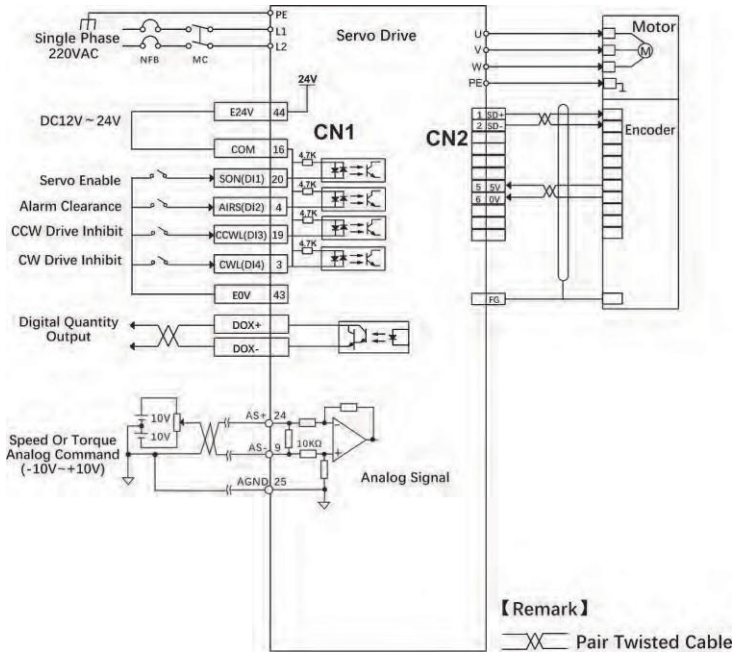


Figure 5.6 Torque modewiring diagram

5.3.3 FArparameter Settings In Torque Mode

5.3.3.1 Torque control mode need to adjust FArparameter

FArparameter	FArparameter Description	Value	Default
FA4	Control method selection	2	0
FA29	Analog torque command input gain	Set as needed	30
FA32	Internal and external torque command selection	0-2	0
FA33	Analog torque command input direction is reversed	0	0

Chapter5

FParameter	FParameter Description	Value	Default
FA39	Analog torque command zero offset compensation	0	0
FA50	Speed limit during torque control	Set as needed	Rated speed
FA64	Internal torque 1	-300-300	0
FA65	Internal torque 2	-300-300	0
FA66	Internal torque 3	-300-300	0
FA67	Internal torque 4	-300-300	0
FA83	Prohibition method	0-1	0
FA89	Reach torque	-300%-300%	100
FA90	Reached torque difference	0%-300%	5
FA91	Reached torque polarity	0-1	0

5.4 Origin Regression function and description of relevant FParameters

5.4.1 Relevant FParameter Settings

FParameter	FParameter Description	Value	Default
FD-32	Origin detector type and search direction setting	0-5	0
FD-33	Short-distance movement method setting to reach the origin	0-2	0
FD-34	Origin trigger start mode	0-2	0
FD-35	Origin stop mode setting	0-1	0
FD-36	The first stage of high-speed home return speed setting	1-2000 r/min	1000
FD-37	The second stage of low-speed home return speed setting	1-500r/min	50
FD-38	Origin return offset circle number	+/-30000	0
FD-39	Origin return offset pulse number	+/-maxcnt	0

5.4.2 Origin Regression Mode Introduction(Must be in internal position mode)

5.4.2.1 Origin trigger start mode (FD-34)

The origin trigger start mode is divided into two categories: the automatic execution origin regression function and the contact trigger origin regression function:

FD-34=0: Turn off origin regression. When FD-34 is set to 0, the origin regression function does not start regardless of the other setpoints.

FD-34=1: The origin regression function is automatically performed when the power is on. This function is only valid once when power supply and servo start up inputs are made, i.e. under operating conditions where servo operation does not require repeated regression. Use this feature to omit an input contact to perform regression origin.

FD-34=2: The origin regression function is triggered by the SOM input contact. When setting this function, any register in the input pin function planning register (FC-0 to FC-3) must be set to the SOM trigger origin input function. THE Servo connection can be triggered at any time during servo operation and the origin regression function can be performed.

B. Origin detector type and direction setting (FD-32)

The origin detector can use the left or right limit switch as the origin reference point, or additional detectors, such as proximity or light gate switches, can be used as the origin reference point. The Z pulse can also be set as the origin reference point when the servo motor is only moving within one turn.

FD-32=0: Look for the origin in the forward direction and use the CCWL limit input point as a rough reference point for the origin. When origin positioning is complete, CCWL moves to the limit input function. Subsequent re-triggering will generate a limit warning, and when using the limit input point as a rough reference point for the origin, it is recommended to set the return to look for the Z pulse(FD-33=0) as the exact mechanical origin.

FD-32=1: The reverse direction looks for the origin and takes the CWL limit input point as a rough reference point for the origin. When origin positioning is complete, the CWL moves to the limit input function. Subsequent re-triggering will produce an extreme warning, and when using the limit input point as a rough reference point for the origin, it is recommended to set the return look for the Z pulse(FD-33s0) as the exact mechanical origin.

FD-32=2: Forward direction to find the origin, and orGP (external detector input point) as the reference point of the origin, at this time the precise mechanical origin can be set to return to look for(FD-33s 0) or not return to look for (FD-33s1) Z-phase pulse. When the Z-phase pulse is not used as the mechanical origin, the positive edge of orGP can also be set to the mechanical origin(FD-33s2).

FD-32=3: The reverse direction looks for the origin and uses ORGP (external detector input point) as the reference point for the origin. The precise mechanical origin can then be set to return a search(FD-33s0) or not a Z-phase pulse to look for(FD-33s1). When the Z-phase pulse is not used as the mechanical origin, the positive edge of orGP can also be set to the mechanical origin(FD-33s2).

FD-32=4: Forward direction directly looking for the absolute position zero of the single turn, this function is typically used for servo motors only in a range of motion control, at this time can not be external to any detection switch.

FD-32=5: Invert direction directly looking for the absolute position zero of the single turn, this function is typically used for servo motors only in a range of motion control, at this time can not be attached to any detection switch.

C. Movement mode setting of short distance to the origin (FD-33)

FD-33=0: After finding the reference origin, the motor folds back to find the nearest absolute position zero point at the second speed as the mechanical origin.

FD-33=1: After finding the reference origin, the motor turns to the second stage speed and continues to look forward for the nearest single-lap absolute position zero as the mechanical origin.

FD-33=2: Find the rising edge of the detector ORGP as the mechanical origin and slow down to stop, suitable for FD-32 values of 2 and 3 settings, or find the absolute position of the single lap zero point and slow stop, suitable for FD-32 value of 4 and 5 settings.

D. The mode setting of origin point stops (FD-35)

FD-35=0: After the origin detection is complete, the motor decelerates and pulls back to the origin. After the origin heartbeat is obtained during the second speed operation, the motor deceleration stops. Stop and then move to the mechanical origin position at a two-stage speed.

FD-35=1: After the origin detection is complete, the motor slows down in the forward direction and stops. After the origin heartbeat is obtained during the second speed operation, the motor deceleration stops. The positional override after the stop is no longer corrected, at which point the position of the mechanical origin does not change depending on the amount of position

override.

5.5Pre- operation Inspection

First remove the load connected to the servo motor, the coupling connected to the servo motor shaft, and its associated accessories. Ensure that the servo motor works properly without load before connecting the load to avoid unnecessary hazards.

Before you run, check and make sure that:

- 1) There is no obvious damage to the appearance of the servo drive;
- 2) The wiring terminals have been insulated;
- 3) there are no conductive objects or flammable objects such as screws or metal pieces inside the driver, and there are no conductive foreign objects at the wiring ports
- 4) e servo drive or external braking resistor is not placed on combustible objects;
- 5) The wiring is completed and the wiring is correct

The drive power supply, auxiliary power supply, ground terminal and so on are wired correctly, each control signal cable is wired correctly, and the limit switch and protection signal are all properly wired.

- 1) The enable switch has been placed in the OFF state;
- 2) t off the power circuit and the emergency stop alarm circuit to maintain the access;
- 3) The applied voltage reference of the servo drive is correct.




Power up the servo drive without the controller sending a run command signal. Check and guarantee:

- 1) The servo motor can rotate normally without vibration or excessive running sound;
- 2) The FArAmeters are set correctly. Unexpected actions may occur depending on the mechanical characteristics. Please do not over-set extreme FArAmeters;
- 3)There is no abnormality in bus voltage indicator and digital tube display.

Character 6 Operation and Display

6.1 Drive FAnel Introduction

6.1.1 Front FAnel

The FAnel consists of 5 LED digital tube displays and 4 buttons    **SET**. It is used to display various system statuses, set FAnel parameters, etc. Actions are hierarchical actions that are expanded layer by layer by the main menu.

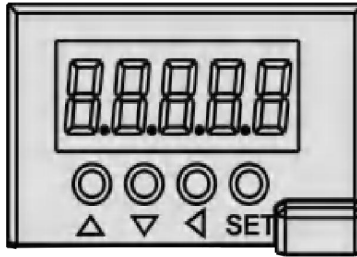







Figure 6.1 Drive FAnel display interface

6.1.2 Key introduction

Symbol	Name	Function
	Increasing	Increase sequence number or value; Press and hold to keep increasing
	Decreasing	Decrease sequence number or value; Press and hold to keep decreasing
	Exit	Menu exit or cancel the operation
SET	Confirm	Menu entered or confirm the operation

6.2 Main menu

The first layer is the main menu, there are 8 ways to operate,   Keys to change the mode, press the **SET** key to enter the second layer, perform specific operations, and press the key to return to the main menu from the second layer.

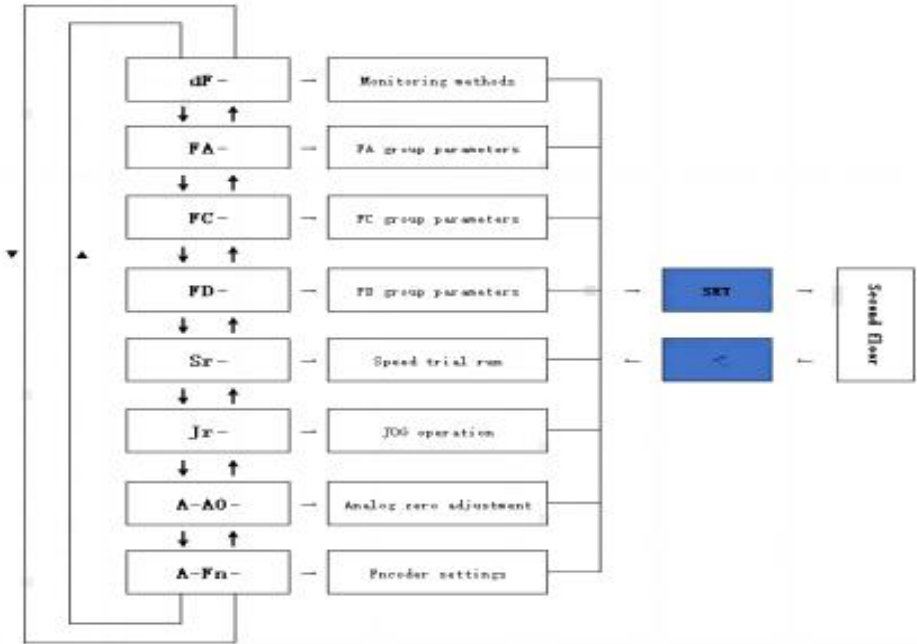






Figure 6.2 Block diagram of the main menu operation

6.3 Steps To Set FArameters

FArameters are represented by FArameter segment + FArameter number, the hundreds digit is the segment number, and the tens and ones digits are the FArameter numbers. For example, for FArameter FA53, the segment number is "FA", the FArameter number is "53", and the display shows "FA-53".

Select the FArameter setting "P-" in the **main** menu, and press the **SET** key to enter the FArameter setting mode. First use the   keys to select the FArameter section, after selecting, press the **SET** key to enter the FArameter number selection of this section. Secondly, use the   keys to select the FArameter number, after selecting, press the SET key to display the FArameter

value.

Use ▲, ▼ keys to modify the FArparameter value. Press ▲ or ▼ key once to increase or decrease the FArparameter by 1, press and hold ▲ or ▼, to continuously increase or decrease the FArparameter. When the FArparameter value is modified, press the SET key, the decimal point of the rightmost LED digital tube lights up and flashes twice, that is, the modification is completed, and the modified value will be immediately reflected in the control (some FArparameters need to be saved and then powered on again to take effect).

6.4 Monitoring Status

The first layer is used to choose how to operate, there are 8 ways, Use ▲, ▼ keys to change the mode, press the SET key to enter the second layer of the selected mode, and press the ◀ key to return to the first layer from the second layer.

Select "dp--" in the first layer, and press the SET key to enter the monitoring mode. There are a total of 23 display states, The user selects the desired display mode with the ▲, ▼ keys, and then presses the SET key to enter the specific display state.

Monitoring method	Operate	Monitoring example	Illustrate
F-SFD	SET	r 1000	Motor speed 1000r/min
F-POS		04580	Current position124580
F-POS.		P. 12	
F-CPo		C4581	Position command124581
F-CPo.		C. 12	
F-EPo		E 4	Position deviation 4 pulses
F-EPo.		E. 0	
F-trq		t 0.70	Motor torque 70%
F-I		I 2.3	Motor current 2.3A
F-Cnt		Cnt 0	Current control mode 0: Position control mode




Chapter6

Monitoring method	Operate	Monitoring example	Illustrate
F-tEp		r. 500	The speed corresponding to the analog input in speed mode is 500 r/min.
F-Ct		t 0.50	The torque corresponding to the analog input in torque mode is 50%.
F-APo		A3265	The absolute position of the rotor is 3265.
F-APo.		A. 0	
F-In		n IIII	Input terminal
F-oUt		oUt.III	Output terminal
F-udc		UC336	us voltage 336V
F-Err		Err 4	Alarm No. 4
F-rl	rl-on	Relay open state	
	rl-of	Relay off state	
	rl-er	Relay alarm status	
F-rn	rn-on	The main circuit is operating normally	
	rn-of	The main circuit is not charged	
	rn-CH	The main circuit is charged but the servo is not enabled	
	rn-er	Main circuit alarm	
F-US	U-on	Bus voltage is normal	
	U-.LoU	Bus voltage is too low	
	U-Err	There is an alarm	
F-AS	43210	Motor absolute position 876543210	
F-AS.	A.8765		


6.5 Analog Quantity Zeroing Adjustment

With this operation, the drive automatically detects the analog zero bias and writes the zero bias value to FArparameter FA39 (or FA45). This operation has saved

the zero-bias FArparameter to EEPROM, so no more FArparameter writes are required.

First select the analog zero "A-A0" and press **SET** to enter. Then select speedanalog zero adjustment "A-SPd" or torque analog zero adjustment "A-Trq" through , , and after selecting the operation, press and hold the **SET** key for more than 3 seconds, and activate the operation after "donE" is displayed. After finishing, you can press  again to return to the menu selection state.

6.6 Encoder Selection

Select "F-res" to reset the encoder operation, the encoder multi-circle information zero, through the FC-36 FArparameter value setting, the single-circle information can be zeroed to achieve the purpose of the origin; Press and hold the SET key for more than 3 seconds after selecting the operation, and after "donE" is displayed, activate the action. When you're done, press  to return to the menu selection state.







6.7 How To Reset Default FArparameters

Use the Restore Default (Factory FArparameters) function if:

- The FArparameters are scrambled and the system does not work properly.

The steps to restore the default FArparameters are as follows:

1. The motor needs to be connected to the drive, and after power-on, the drive will automatically read the motor FArparameters and automatically match the motor model.
2. Change the FAssword (FA0) to 358.
3. Enter FArparameter management and perform the following operations:

All FArparameters are restored as the default, and user-modified FArparameters are restored to factory defaults. Press  to return to the main menu, use ,  select "FA-" mode, press set key to enter the second layer of the interface, and then press ,  so that FA-0, then press **SET** into the third layer of interface, FA0 set to the value 358, press **SET** to save. Next press  to return to the "FA-" interface, and set FA1 to DEF-, press **SET** for 5 seconds, wait for the LED to flash a few times, complete the default FArparameter saving. Finally, power on again is valid.

Chapter 7 FArameters Function Instruction

7.1 FAGroup FAra

Seq	name	function	FAr Range	Default
0	FAssword	1. The user FAssword is 315. 2. The model code is 385.	0-9999	315
1	Model code	This FArparameter is read-only and cannot be modified. The driver automatically recognizes the motor model without selecting it	40-80	Sheet 7-1
2	Software version	You can view the software version number, but you cannot modify it.		

Sheet7-1

Driver	Q300-40	Q300-75
Motor	40-00130	80-01330
	40-00330	80-02430
	60-00630	80-03230
	60-01330	--
	60-01930	--
	80-01330	--

Seq	name	Function	FAra.range	default
3	Initial display state	1: Display the lower 5 digits of the current position;		
		2: Display the upper 5 digits of the current position;		
		3: Display the lower 5 digits of position command (accumulated amount of command pulse);		
		4: Display position command (accumulated amount of command pulse) high 5 digits;		
		5: Display the lower 5 digits of the		

Chapter7

Seq	name	Function	FAra.range	default	
		position deviation;	0-25	0	
		6: Display position deviation high 5 digits;			
		7: Display motor torque;			
		8: Display motor current;			
		9: Current control mode;			
		10: Display the current temperature;			
		11: Display speed command;			
		12: Display torque command;			
		13: Display the lower 5 positions of the absolute position of the rotor in one revolution;			
		14: Display the upper 5 digits of the absolute position of the rotor in one revolution;			
	Initial display state	15: Display the status of the input terminal;			
		16: Display the status of the output terminal;			
		17: Display the encoder input signal;			
		18: Display the bus voltage value of the main circuit;			
		19: Display the alarm code;			
		20: Display the version number of the logic chip			
		21: Display the pull-in state of the relay;			
		22: Display running status;			
		23: Display the external voltage status;			
		24: Display the lower 5 digits of the absolute value position;			
	25: Display the upper 5 digits of the absolute value position;				
		This FArparameter allows you to set the way the drive is controlled;			
	4	Control method selection	0: Position control mode;	0-6	0
			1: speed control mode;		
			2: torque control mode;		
3: Position speed mixed control mode;					
4: Position torque mixing control mode;					

Chapter7

Seq	name	Function	FAra.range	default
		5: Speed torque mixing control mode; 6: Encoder zero mode.		
5	Speed proportion al gain	<ol style="list-style-type: none"> 1. Set the proportional gain of the speed ring regulator. 2. The higher the set value, the higher the gain and the greater the stiffness. The FArparameter values are determined according to the specific servo drive system model and load conditions. In general, the greater the load inertia, the larger the setting. 3. Set as large as possible without oscillating the system. 	5-2000HZ	150
6	Speed integral constant	<ol style="list-style-type: none"> 1. . Set the integral time constant of the speed loop regulator. 2. The smaller the setting value, the faster the integration speed, and the stronger the system resists deviation, that is, the greater the stiffness, but too small an overshoot is likely to occur. 	1-1000 ms	75
7	Torque filter	<ol style="list-style-type: none"> 1. Set the torque command filter characteristics. 2. Used to suppress the resonance generated by the torque. 3. The smaller the value, the lower the cut-off frequency, and the less vibration and noise the motor produces. If the load inertia is large, the set value can be reduced appropriately. The value is too small, causing the response to slow down and may cause oscillations. 4. The higher the value, the higher the cutoff frequency and the faster the response. If a high torque response is required, the setting can be increased appropriately. 	20-500%	100
		1. Set the speed detection filter characteristics.	20-500%	100

Chapter7

Seq	name	Function	FAra.range	default
8	Speed detection filter	<p>2. The smaller the value, the lower the cut-off frequency, and the less noise the motor produces. If the load inertia is large, the set value can be reduced appropriately. The value is too small, causing the response to slow down and may cause oscillations.</p> <p>3. The higher the value, the higher the cutoff frequency, and the faster the feedback response. If a high speed response is required, the setting can be increased appropriately.</p>		
9	Position proportion al gain	<p>1. Set the proportional gain of the position ring regulator.</p> <p>2. The higher the set value, the higher the gain, the greater the stiffness, the smaller the position lag under the same frequency command pulse conditions. However, a value that is too large may cause oscillations.</p> <p>3. The FAparameter values are determined according to the specific servo drive system model and load conditions.</p>	1-1000	80
11	Number of command pulses per motor revolution	<p>1. Set the number of command pulses equivalent to 1 revolution per rotation of the motor.</p> <p>2. When the setting value is 0, FA-12 (position command pulse divider molecule) and FA-13 (position command pulse divider) are valid.</p>	0-30000	10000
12	Position command pulse electronic gear first numerator	<p>1. Set the division/multiplication frequency of the position command pulse (electronic gear).</p> <p>2. In the position control mode, by setting the FAparameters of FA12 and FA13, it can be easily matched with various pulse sources to achieve the user's ideal control resolution (i.e angle/pulse).</p>	0-32767	0

Chapter7

Seq	name	Function	FAra.range	default																	
		<p>3. $P \times G = N \times 131072$.</p> <p>P: Number of pulses for input instructions; G: electronic gear ratio; G= frequency division numerator/frequency division denominator N: motor rotation number 131072: The default number of pulses for one revolution of the motor is 131072.</p> <p>4. For example, when the input command pulse is 6400, the servo motor rotates one revolution $G = (N \times 131072) / P = (1 \times 131072) / 6400 = 512 / 25$, Then the FArparameter FA12 is set to 512, and FA13 set as 25.</p> <p>5. The numerator of the command pulse electronic gear is determined by Gear1 and Gear2. The denominator is set by FArparameter FA13. The combination is as follows:</p> <table border="1" style="width: 100%; border-collapse: collapse; margin-top: 10px;"> <thead> <tr style="background-color: #cccccc;"> <th colspan="2" style="text-align: center;">DI signal(Note) 注: 0 表示 OFF, 1 表示 ON。</th> <th rowspan="2" style="text-align: center;">Command pulse electronic gear denominator</th> </tr> <tr style="background-color: #cccccc;"> <th style="text-align: center;">Gear2</th> <th style="text-align: center;">Gear1</th> </tr> </thead> <tbody> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">0</td> <td style="text-align: center;">First molecule (FArparameter FA12)</td> </tr> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">1</td> <td style="text-align: center;">Second molecule (FArparameter FA 77)</td> </tr> <tr> <td style="text-align: center;">1</td> <td style="text-align: center;">0</td> <td style="text-align: center;">Third molecule (FArparameter FA 78)</td> </tr> <tr> <td style="text-align: center;">1</td> <td style="text-align: center;">1</td> <td style="text-align: center;">Fourth molecule (FArparameter FA 79)</td> </tr> </tbody> </table> <p style="font-size: small; margin-top: 5px;">Note: 0 means OFF, 1 means ON</p>	DI signal(Note) 注: 0 表示 OFF, 1 表示 ON。		Command pulse electronic gear denominator	Gear2	Gear1	0	0	First molecule (FArparameter FA12)	0	1	Second molecule (FArparameter FA 77)	1	0	Third molecule (FArparameter FA 78)	1	1	Fourth molecule (FArparameter FA 79)		
DI signal(Note) 注: 0 表示 OFF, 1 表示 ON。		Command pulse electronic gear denominator																			
Gear2	Gear1																				
0	0	First molecule (FArparameter FA12)																			
0	1	Second molecule (FArparameter FA 77)																			
1	0	Third molecule (FArparameter FA 78)																			
1	1	Fourth molecule (FArparameter FA 79)																			
13	Position command pulse electronic gear denominator or	See FArparameters FA12.	1-32767	10000																	
14	Position command	1. Set the input form of the position command pulse.	0-3	0																	

Chapter7

Seq	name	Function	FAra.range	default
	pulse input method	<p>2. Set the FParameters to one of the three input modes: 0: Pulse-plus direction; 1: CCW pulse/CW pulse; 2: A, B two-phase orthogonal pulse input; 3: Internal location input. Note: CCW is axial observation from the servo motor, rotating in an anticlockwise direction, defined as forward, and CW is observed from the axial direction of the servo motor, rotating clockwise, defined as reverse.</p>		
15	Inverted command pulse direction	<p>Set to: 0: Normal; 1: Position command pulse direction is reversed.</p>	0-1	0
16	Positioning completion range	<p>1. Position the complete pulse range under position control. 2. This FArparameter provides the basis for the drive to determine whether to complete the positioning under position control. When the remaining pulses in the position deviation counter are less than or equal to the set value of this FArparameter, the digital output DO's COIN (positioning complete) ON, otherwise OFF. 3. The comFArator has a return function. Set by FArparameter FA84.</p>	0-30000 Pulse	130
17	Position tolerance range detection	<p>1. Set the position difference alarm detection range. 2. Under position control mode, the driver gives a position alarm when the value of the position deviation counter exceeds the value of this FArparameter.</p>	0-30000 ×100 Pulse	6000
18	Invalid position error	<p>Set to: 0: Positional difference alarm detection is effective;</p>	0-1	0

Chapter7

Seq	name	Function	FAra.range	default
		1: Position difference alarm detection is not valid, stop detection location error.		
19	Position command smoothing filter	<p>1. Smooth filtering of the command pulse, with exponential acceleration and deceleration, the value represents the time constant.</p> <p>2. The filter does not lose input pulses, but instruction delays occur.</p> <p>3. This filter is used to:</p> <p>1The upper controller has no deceleration function;</p> <p>2Electronic gears are multiplied in larger frequencies (> 10);</p> <p>3The instruction frequency is low.</p> <p>4. Step jumps and unevenness occur when the motor is running.</p> <p>5. When set to 0, the filter does not work.</p>	0-1000× 0.1ms	100
20	Drive prohibition input is invalid	<p>Set as: 0: CCW, CW input prohibition is valid. When the CCW drive prohibition switch (FSTP) is ON, the CCW drive is allowed; when the CCW drive prohibition switch (FSTP) is OFF, the CCW direction torque remains at 0; the same is true for CW. If both CCW and CW drive prohibitions are OFF, a drive prohibition input error alarm will be generated; 1: Cancel CCW and CW input prohibition. Regardless of the status of the CCW and CW drive prohibition switches, both CCW and CW drive are allowed. At the same time, if both CCW and CW drive prohibition are OFF, no drive prohibition input error alarm will be</p>	0-1	1

Chapter7

Seq	name	Function	FAra.range	default																	
		generated.																			
21	JOG running speed	Set the speed at which the JOG operation will run.	0-6000 r/min	100																	
22	Speed command source	<p>During speed control, set the source of the speed command, the meaning of the FArparameter: 0: Analog speed command is input by analog port AS+, AS-; 1: Internal speed command, determined by SP1 and SP2 input by DI:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th colspan="2" style="text-align: left;">DI Signals (Notes)</th> <th rowspan="2" style="text-align: center;">Command pulsed electronic gear denominator</th> </tr> <tr> <th style="text-align: center;">SP2</th> <th style="text-align: center;">SP1</th> </tr> </thead> <tbody> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">0</td> <td>Internal speed 1 (FAra FA24)</td> </tr> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">1</td> <td>Internal speed 2 (FAra FA25)</td> </tr> <tr> <td style="text-align: center;">1</td> <td style="text-align: center;">0</td> <td>Internal speed 3 (FAraFA26)</td> </tr> <tr> <td style="text-align: center;">1</td> <td style="text-align: center;">1</td> <td>Internal speed 4 (FAraFA27)</td> </tr> </tbody> </table> <p>Note: 0 means OFF, 1 means ON. 3: JOG speed command, when inching (JOG) operation, Need to be set. 4: Keyboard speed command, when performing keyboard speed regulation (Sr) operation, Need to be set. 5: IO terminal controls jog operation.</p>	DI Signals (Notes)		Command pulsed electronic gear denominator	SP2	SP1	0	0	Internal speed 1 (FAra FA24)	0	1	Internal speed 2 (FAra FA25)	1	0	Internal speed 3 (FAraFA26)	1	1	Internal speed 4 (FAraFA27)	0-5	0
DI Signals (Notes)		Command pulsed electronic gear denominator																			
SP2	SP1																				
0	0	Internal speed 1 (FAra FA24)																			
0	1	Internal speed 2 (FAra FA25)																			
1	0	Internal speed 3 (FAraFA26)																			
1	1	Internal speed 4 (FAraFA27)																			
23	Maximum speed limit	<p>Set the maximum speed limit for the servo motor.</p> <p>1.No related to the direction of rotation. 2. If the setting exceeds the rated speed, the actual maximum speed limit is the rated speed.</p>	0-6000r/min	5000																	
24	Internal speed 1	<p>1. Set the internal speed1. 2. Speed control mode (FA22=0),</p>	-6000-6000	100																	

Chapter7

Seq	name	Function	FAra.range	default											
		when SP1 OFF, When SP2 OFF, select internal speed 1 as the speed instruction.	r/min												
25	Internal speed2	1. Set internal speed 2. 2. In speed control mode (FA22=0), when SP1 is ON and SP2 is OFF, select internal speed 2 as the speed indicator.	-6000-6000 r/min	500											
26	Internal speed 3	1. Set the internal speed 3. 2. Under speed control (FA22-0), when SP1 OFF, SP2 ON, select the internal speed 3 as the speed command.	-6000-6000 r/min	1000											
27	Internal speed 4	1. Set the internal speed4. 2. Under speed control (FA22-0), when SC1 ON, SC2 ON, select the internal speed 4 as the speed command.	-6000-6000 r/min	2000											
28	Arrival speed	<p>1. When the motor speed exceeds this FArator, the ASP of the digital output DO (Speed reached) ON, otherwise OFF.</p> <p>2. The comFArator has a hysteresis function, which is set by FArator FA87.</p> <p>3. With polarity setting function:</p> <table border="1" style="margin-left: auto; margin-right: auto;"> <thead> <tr> <th>FA88</th> <th>FA28</th> <th>ComFArator</th> </tr> </thead> <tbody> <tr> <td>0</td> <td>>0</td> <td>Speed regardless of direction</td> </tr> <tr> <td rowspan="2">1</td> <td>>0</td> <td>Only positive speed is detected</td> </tr> <tr> <td><0</td> <td>Only the reversal speed is detected</td> </tr> </tbody> </table>	FA88	FA28	ComFArator	0	>0	Speed regardless of direction	1	>0	Only positive speed is detected	<0	Only the reversal speed is detected	0-3000 r/min	3000
FA88	FA28	ComFArator													
0	>0	Speed regardless of direction													
1	>0	Only positive speed is detected													
	<0	Only the reversal speed is detected													
29	Analog torque command input gain	<p>1. Set the proportional relationship between the analog torque input voltage and the actual running torque of the motor.</p> <p>2. The unit of the set value is 0.1v/100%.</p> <p>3. The default value is 30, corresponding to 3v/100%, that is, inputting 3v voltage produces 100% rated torque.</p>	10-100 (0.1v/100%)	30											

Chapter7

Seq	name	Function	FAra.range	default																		
30	User torque overload alarm value	<p>1. Set the user torque overload value, which is a percentage of the rated torque, the torque limit value regardless of direction, both positive and negative directions are protected.</p> <p>2. In the case of FA31>9, when the motor torque > FA30, the duration > FA31 case, the driver alarm, alarm number is Err-29, the motor stop. After the alarm is generated, the drive must be re-powered up to clear the alarm.</p>	1-300	300																		
31	User torque overload alarm detection time	<p>1. User torque overload detection time, in milliseconds.</p> <p>2. When set to zero, the user torque overload alarm does not work.</p>	0-32767	0																		
32	Torque command source	<p>During torque control, set the source of torque command:</p> <p>0: Analog torque command, input by analog ports AS+ and AS-.</p> <p>1: Internal torque command, determined by TRQ1 and TRQ2 input by DI:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th colspan="2" style="text-align: left;">DI Signals (Notes)</th> <th style="text-align: left;">Torque command</th> </tr> <tr> <th style="text-align: center;">TRQ2</th> <th style="text-align: center;">TRQ1</th> <th></th> </tr> </thead> <tbody> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">0</td> <td>Internal torque 1 (FAparameter FA64)</td> </tr> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">1</td> <td>Internal torque 2 (FAparameter FA65)</td> </tr> <tr> <td style="text-align: center;">1</td> <td style="text-align: center;">0</td> <td>Internal torque 3 (FAparameter FA66)</td> </tr> <tr> <td style="text-align: center;">1</td> <td style="text-align: center;">1</td> <td>Internal torque 4 (FAparameter FA67)</td> </tr> </tbody> </table> <p>2: Analog torque command + internal torque command:</p>	DI Signals (Notes)		Torque command	TRQ2	TRQ1		0	0	Internal torque 1 (FAparameter FA64)	0	1	Internal torque 2 (FAparameter FA65)	1	0	Internal torque 3 (FAparameter FA66)	1	1	Internal torque 4 (FAparameter FA67)		
DI Signals (Notes)		Torque command																				
TRQ2	TRQ1																					
0	0	Internal torque 1 (FAparameter FA64)																				
0	1	Internal torque 2 (FAparameter FA65)																				
1	0	Internal torque 3 (FAparameter FA66)																				
1	1	Internal torque 4 (FAparameter FA67)																				

Chapter7

Seq	name	Function		FAra.range	default																							
		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="2">DI Signals</td> <td rowspan="2" style="vertical-align: top;">Torque command</td> </tr> <tr> <td colspan="2">(Notes)</td> </tr> <tr> <td style="width: 50%;">TRQ2</td> <td style="width: 50%;">TRQ1</td> <td></td> </tr> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">0</td> <td>Analog torque command</td> </tr> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">1</td> <td>Internal torque 2 (FAparameter FA65)</td> </tr> <tr> <td style="text-align: center;">1</td> <td style="text-align: center;">0</td> <td>Internal torque 3 (FAparameter FA66)</td> </tr> <tr> <td style="text-align: center;">1</td> <td style="text-align: center;">1</td> <td>Internal torque 4 (FAparameter FA67)</td> </tr> <tr> <td colspan="3">Note: 0 means OFF, 1 means ON.</td> </tr> </table>		DI Signals		Torque command	(Notes)		TRQ2	TRQ1		0	0	Analog torque command	0	1	Internal torque 2 (FAparameter FA65)	1	0	Internal torque 3 (FAparameter FA66)	1	1	Internal torque 4 (FAparameter FA67)	Note: 0 means OFF, 1 means ON.				
DI Signals		Torque command																										
(Notes)																												
TRQ2	TRQ1																											
0	0	Analog torque command																										
0	1	Internal torque 2 (FAparameter FA65)																										
1	0	Internal torque 3 (FAparameter FA66)																										
1	1	Internal torque 4 (FAparameter FA67)																										
Note: 0 means OFF, 1 means ON.																												
33	Analog torque command input direction Take the opposite	Polarity reverse for analog torque input.		0-1	0																							
34	Internal CCW torque limit	<p>1. The setting value is a percentage of the rated torque, for example, 200 if it is set to 2 times the rated torque.</p> <p>2. This restriction is in effect at all times.</p> <p>3. If the set value exceeds the maximum overload caFAcity allowed by the system, the actual torque is limited to the maximum overload caFAcity allowed by the system.</p>		0-300%	300																							
35	Internal CW torque limit	<p>1. The setting value is a percentage of the rated torque, e.g. 2 times the rated torque, then the setting value is -200.</p> <p>2. This restriction is in effect at all times.</p> <p>3. If the set value exceeds the maximum overload caFAcity allowed by the system, the actual torque is limited to the maximum overload caFAcity allowed by the system.</p>		-300-0%	-300																							

Chapter7

Seq	name	Function	FAra.range	default
36	External CCW torque limit	<p>1. The setting value is a percentage of the rated torque, for example, 100 if it is set to 1 times the rated torque.</p> <p>2. This limit is valid only when CCW torque limit input terminal (CCWL)ON is used.</p> <p>3. When the limit is in effect, the actual torque limit is the minimum of the maximum overload caFacity allowed by the system, the internal CCW torque limit, and the external CCW torque limit.</p>	0-300%	100
37	External CW moment limit	<p>Set the external torque limit in the CW direction of the servo motor.</p> <p>1. The setting value is a percentage of the rated torque, for example, 1 times the rated torque, the setting value is -100.</p> <p>2. This limit is valid only when the CW torque limit input terminal (CWL)ON is used.</p> <p>3. When the limit is in effect, the actual torque limit is the minimum absolute value of the maximum overload caFacity allowed by the system, the internal CW torque limit, and the external CW torque limit.</p>	-300-0%	-100
38	Temperatu re alarm value	Set the drive temperature to the upper alarm value.	200- 1350	
39	Zero-bias compensatio n for analog torque commands	Zero-bias compensation for the analog torque input.	-2000- 2000	0
40	Acceleratio n time constant	<p>The setting value is the acceleration time of the motor from 0-1000r/min.</p> <p>1. The acceleration and deceleration characteristics are linear.</p> <p>2. Only for speed control and internal position control, other control methods are not valid.</p>	1-10000 ms	100

Chapter7

Seq	name	Function	FAra.range	default
41	Deceleration time constant	The setting value is to indicate the deceleration time of the motor from 1000-0r/min. 1. The acceleration and deceleration characteristics are linear. 2. Only for speed control and internal position control, other control methods are not valid.	1-10000 ms	100
42	S type acceleration & deceleration time constant	To smooth the start and stop of the motor, set the S-type plus-deceleration curve FArt of the time.	0-1000ms	0
43	Analog speed command input gain	Sets the proportional relationship between the analog speed input voltage and the actual running speed of the motor.	10-3000 r/min/v	300
44	The direction of the analog speed command is reversed	Polarity reverses to the analog speed input. 1. When set to 0, the analog speed command is positive and the speed direction is CCW. 2. When set to 1, the analog speed command is positive and the speed direction is CW.	0-1	0
45	Analog speed command zero offset compensation	Zero-bias compensation for analog speed input.	-5000-5000	0
46	Analog speed command filter	1. Low-FAss filter for analog speedinput. The larger the setting, the fasterthe response speed to the speedinput analog volume, the greater thesignal noise imFACT, the smaller the setting,the slower the response speed, thesmaller the signal noiseimFACT.	1-1000 Hz	300
47	Mechanical brake	1. Define the delay time fromthe mechanical brake action (output BRKfrom ON to OFF) to the motor	0-200 ×10ms	0

Chapter7

Seq	name	Function	FAra.range	default
	action setting when the motor stops	currentcut-off during motorstop. This FArparameter should not be less than the delay time (Tb) of the mechanicalbrake to avoid minor displacements oroperating drops of themotor.		
48	Mechanical brake action setting when the motor is running	1. Define the delay time from themotor current cut off to the mechanicalbraking action (output BRK from ON to OFF)during motorstop. 2. This FArparameter is designed to allowthe motor to slow down from thetelling rotation to a low speed, and then tomake the mechanical brake action toavoid damage to thebrake. The actual action time is the time required for the FA48 or motor to decelerate to the FA49 value, takingboth minimumvalues.	0-200 ×10ms	50
49	Operating speedof the mechanical brakewhen themotor is running	1. Define the speed value from themotor current cut off to the mechanicalbrake action (output terminal BRK changedfrom ON to OFF) during motoroperation. The actual action time is the time required for the FA48 or motor to decelerate to the FA49 value, takingthe minimum ofboth.	0-3000 r/min	100
50	Speed limit during torque control	1. When torque control is in place,the motor operating speed is limited tothis FArparameter. Speeding on light loads canbe prevented.	0-5000 r/min	3000
53	Servo forced enable	Set to 0: The enable signal is controlled bythe SON input ofDI; 1: Software forceenablement.	0-1	0
54	Servo enable delay close time	Defines the time when the motor current is delayed when the servo enable signal is switched off.	0-30000 ms	0
55	Input terminal	Set the input terminal to reverse. Terminals that do not take reverses are	0000-1111	0000

Chapter7

Seq	name	Function	FAra.range	default								
	effective level control word	<p>valid when the switch is open and closed, and terminals that are not valid when the switch is open and closed, and terminals that are not valid when the switch is switched off.</p> <p>In the form of a 4-bit binary number, the bit of 0 indicates that the output terminal represents no reversal, and 1 represents the counter-measure of the output terminal.</p> <p>The input terminals represented by binary numbers are as follows:</p> <table border="1" style="margin-left: auto; margin-right: auto;"> <tr> <td style="text-align: center;">3</td> <td style="text-align: center;">2</td> <td style="text-align: center;">1</td> <td style="text-align: center;">0</td> </tr> <tr> <td style="text-align: center;">DI4</td> <td style="text-align: center;">DI3</td> <td style="text-align: center;">DI2</td> <td style="text-align: center;">DI1</td> </tr> </table> <p>0: High level is effective; 1: Low level is effective.</p>	3	2	1	0	DI4	DI3	DI2	DI1		
3	2	1	0									
DI4	DI3	DI2	DI1									
57	Output terminal effective level control word	<p>Set the output terminal to reverse. The definition of reverse terminals, on and cut-off is the opposite of the standard definition.</p> <p>In the form of a 4-bit binary number, the output terminal represented by 0 is not reversed, and the output terminal represented by 1 is reversed. The input terminals represented by binary numbers are as follows:</p> <table border="1" style="margin-left: auto; margin-right: auto;"> <tr> <td style="text-align: center;">3</td> <td style="text-align: center;">2</td> <td style="text-align: center;">1</td> <td style="text-align: center;">0</td> </tr> <tr> <td style="text-align: center;">DO4</td> <td style="text-align: center;">DO3</td> <td style="text-align: center;">DO2</td> <td style="text-align: center;">DO1</td> </tr> </table> <p>0: High level is effective; 1: Low level is effective.</p>	3	2	1	0	DO4	DO3	DO2	DO1	0000-1111	0000
3	2	1	0									
DO4	DO3	DO2	DO1									
58	IO input terminal debounce time constant	<ol style="list-style-type: none"> 1. De-jitter filtering time for the input terminals. 2. The smaller the value, the faster the terminal input response. 3. The higher the value, the better the anti-jamming performance of the terminal input, but the slower the response. 	1-20ms	2								

Chapter7

Seq	name	Function	FAra.range	default
59	Command pulse valid edge	Set to: 0: Pulse rising edge is effective; 1: The pulse drop edge is valid.	0-1	0
60	Soft reset	0: Soft reset is not valid; 1: The soft reset is valid and the system will restart.	0-1	0
61	System alarm cleared	Set as: 0: System alarm clearing is invalid; 1: The system alarm clearing is effective.	0-1	0
62	Encoder selection	4: Single-circle absolute value encoder; 5: Multi-circle absolute value encoder.	4-5	Determined by the motor
63	Load inertia ratio	1. Set the load inertia ratio of the corresponding motor rotation inertia. 2. The setting is: ((load inertia plus rotational inertia) / rotational inertia) × 100.	1-500	100
64	Internal torque 1	In torque control mode (FA4=2), when TRQ1 is OFF, when TRQ2 is OFF, select internal torque 1 as torque command.	-300-300	0
65	Internal torque 2	In torque control mode (FA4=2), when TRQ1 is ON, when TRQ2 is OFF, select internal torque 2 as torque command.	-300-300	0
66	Internal torque 3	In torque control mode (FA4=2), when TRQ1 is OFF, when TRQ2 is ON, select internal torque 3 as torque command.	-300-300	0
67	Internal torque 4	In torque control mode (FA4=2), when TRQ1 is ON, when TRQ2 is ON, select internal torque 4 as torque command.	-300-300	0
71	MODBUS slave address	MODBUS communication from the machine address value.	1-254	1
72	MODBUS communication baud rate	MODBUS Communication Baud Rate.	48-1152 ×100	96
73	MODBUS	Set to:	0-3	0

Chapter7

Seq	name	Function	FAra.range	default
	communication protocol selection	0: 8, N, 2 (MODBUS, RTU); 1: 8, E, 1 (MODBUS, RTU); 2: 8, O, 1 (MODBUS, RTU); 3: 8, N, 1 (MODBUS, RTU).		
73	MODBUS communication protocol selection	This FArparameter determines the communication protocol, the number 8 indicates that the transmitted data bit is 8 bits, and the English letters N, E, O represent FARity: N: indicates that this bit is not used; E: represents 1 even position; O: Represents 1 odd bit. The number 1 or 2 indicates that the communication bit is 1 or 2 bits.	0-3	0
74	Communication error handling	When the communication signal is wrong, select: 0: Continue to operate; 1: Alarm and stop operation.	0-1	1
75	Zero speed detection point	1. When the motor speed is lower than this FArparameter, the ZSP (zero speed) of the digital output DO is ON, otherwise it is OFF. 2. When the ZCLAMP of the digital input DI is ON and the speed command value is lower than this value, the speed command value is forced to zero.	0-1000 r/min	10
76	Speed consistent setting value	When the difference between the actual speed and the command speed is less than this setting, the UCO2N (speed consistent) of the digital output DO is ON, otherwise it is OFF.	0-1000 r/min	10
77	Position command pulse electronic gear ratio second numerator	See FArparameter FA12 for details.	0-32767	0
78	Position command	See FArparameter FA12 for details.	0-32767	0

Chapter7

Seq	name	Function	FAra.range	default
	pulse electronic gear ratio third numerator			
79	Position command pulse electronic gear ratio fourth numerator	See FArparameter FA12 for details.	0-32767	0
80	Command direction signal effective level	Set as: 0: High level positive direction; 1: Low level positive direction.	0-1	0
81	Command pulse PULS signalfilteri ng	1. For the pulse input PULSE signal digital filtering, the larger the value, the greater the filter timeconstant. 2. By default, the maximum pulse input frequency is 500kHz (kpps), and the larger the value, the lower the maximum pulse input frequency. 3. Used to filter out noise on the signal line to avoid counting errors. If there is a phenomenon of not being allowed to go due to the count, the FArparameter value can be increased appropriately. After the FArparameters have been modified, they must be saved and powered on again before they are valid.	0-15	4
82	Command pulse SIGN signalfilteri ng	1. For the pulse input SIGNAL signal digital filtering, the larger the value, the greater the filter timeconstant. 2. By default, the maximum pulse input frequency is 500kHz (kpps), and the larger the value, the lower the maximum pulse input frequency. 3. Used to filter out noise on the signal line to avoid counting errors. If there is a phenomenon of not being allowed to	0-15	4

Chapter7

Seq	name	Function	FAra.range	default
		go due to the count, the FArAmeter value can be increased appropriately. After the FArAmeters have been modified, they must be saved and powered on again before they are valid.		
83	CWL, CCWL direction prohibition method	1. This FArAmeter is used to select the prohibited method when the machine touches the mechanical limit switch and triggers the CWL, CCWL limit. FArAmeter meaning: 0: Limit the torque in this direction to 0; 1: Pulse input in this direction is prohibited.	0-1	0
84	Positioning complete return difference	1. Position the complete pulse range under position control. 2. When the remaining pulses in the position deviation counter are less than or equal to the set value of this FArAmeter, the digital output DO's COIN (positioning complete) ON, otherwise OFF. The comFArator has a return function, set by FArAmeter FA85.	0-32767 pulse	65
85	Positioning proximity	1. Position close to pulse range under position control. 2. When the remaining pulses in the position deviation counter are less than or equal to the set value of this FArAmeter, the DIGITAL output DO's NEAR (nearby positioning) ON, otherwise OFF. 3. The comFArator has a return function, set by FArAmeter FA86. Used to preFAre for the next step by accepting the NEAR signal when the positioning is about to be completed. The general FArAmeter value is greater than the positioning completion range.	0-32767 pulse	6500
86	Positioning approach difference	See the description of FArAmeter FA85.	0-32767 pulse	65

Chapter7

Seq	name	Function	FAra.range	default											
87	Arrival speed difference	<p>1. When the motor speed exceeds this FArarameter, the ASP (speed arrival) of the digital output DO is ON, otherwise it is OFF.</p> <p>2. The comFArator has a hysteresis function.</p> <p>3. With polarity setting function:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>FA88</th> <th>FA28</th> <th>ComFArator</th> </tr> </thead> <tbody> <tr> <td>0</td> <td>>0</td> <td>Speed regardless of direction</td> </tr> <tr> <td rowspan="2">1</td> <td>>0</td> <td>Only positive speed is detected</td> </tr> <tr> <td><0</td> <td>Only the reversal speed is detected</td> </tr> </tbody> </table>	FA88	FA28	ComFArator	0	>0	Speed regardless of direction	1	>0	Only positive speed is detected	<0	Only the reversal speed is detected	0-5000 r/min	30
FA88	FA28	ComFArator													
0	>0	Speed regardless of direction													
1	>0	Only positive speed is detected													
	<0	Only the reversal speed is detected													
88	Reach speed polarity	Refer to the description of FArarameter FA87.	0-1	0											
89	Reach torque	<p>1. When the motor torque exceeds this FArarameter, the ATRQ (torque arrival) of the digital output DO is ON, otherwise it is OFF.</p> <p>2. The comFArator has a hysteresis function, which is set by the FArarameter FA90.</p> <p>3. With polarity setting function:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>FA88</th> <th>FA28</th> <th>ComFArator</th> </tr> </thead> <tbody> <tr> <td>0</td> <td>>0</td> <td>Speed regardless of direction</td> </tr> <tr> <td rowspan="2">1</td> <td>>0</td> <td>Only positive torque is detected</td> </tr> <tr> <td><0</td> <td>Only the reversal speed is detected</td> </tr> </tbody> </table>	FA88	FA28	ComFArator	0	>0	Speed regardless of direction	1	>0	Only positive torque is detected	<0	Only the reversal speed is detected	-300%- 300%	100
FA88	FA28	ComFArator													
0	>0	Speed regardless of direction													
1	>0	Only positive torque is detected													
	<0	Only the reversal speed is detected													
90	Reached torque difference	<p>1. When the motor torque exceeds this FArarameter, the ATRQ (torque arrival) of the digital output DO is ON, otherwise it is OFF.</p> <p>2. The comFArator has a hysteresis function, which is set by FArarameter FA90.</p> <p>3. With polarity setting function:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>FA88</th> <th>FA28</th> <th>ComFArator</th> </tr> </thead> <tbody> <tr> <td>0</td> <td>>0</td> <td>Speed regardless of direction</td> </tr> <tr> <td rowspan="2">1</td> <td>>0</td> <td>Only positive torque is detected</td> </tr> <tr> <td><0</td> <td>Only the reversal speed is detected</td> </tr> </tbody> </table>	FA88	FA28	ComFArator	0	>0	Speed regardless of direction	1	>0	Only positive torque is detected	<0	Only the reversal speed is detected	0-300%	5
FA88	FA28	ComFArator													
0	>0	Speed regardless of direction													
1	>0	Only positive torque is detected													
	<0	Only the reversal speed is detected													
91	Reached torque polarity	<p>1. When the motor torque exceeds this FArarameter, the ATRQ (torque arrival) of the digital output DO is ON, otherwise it is OFF.</p> <p>2. The comFArator has a hysteresis function,</p>	0-1	0											

Chapter7

Seq	name	Function	FAra.range	default											
		<p>which is set by FArparameter FA90.</p> <p>3.With polarity setting function:</p> <table border="1" style="margin-left: 20px;"> <thead> <tr> <th style="text-align: center;">FA88</th> <th style="text-align: center;">FA28</th> <th style="text-align: center;">ComFArator</th> </tr> </thead> <tbody> <tr> <td style="text-align: center;">0</td> <td style="text-align: center;">>0</td> <td>Speed regardless of direction</td> </tr> <tr> <td rowspan="2" style="text-align: center;">1</td> <td style="text-align: center;">>0</td> <td>Only positive torque is detected</td> </tr> <tr> <td style="text-align: center;"><0</td> <td>Only the reversal speed is detected</td> </tr> </tbody> </table>	FA88	FA28	ComFArator	0	>0	Speed regardless of direction	1	>0	Only positive torque is detected	<0	Only the reversal speed is detected		
FA88	FA28	ComFArator													
0	>0	Speed regardless of direction													
1	>0	Only positive torque is detected													
	<0	Only the reversal speed is detected													
92	Zero speed detection hysteresis	<p>1.When the motor speed is lower than this FArparameter, the digital output DO's ZSP (zero speed) ON, otherwise OFF.</p> <p>2.The comFArator has a return function.</p>	0-1000 r/min	5											
93	Delay time of electromagnetic brake opening	<p>1. Set the delay time for the electromagnetic brake to open.</p>	0-200× 10ms	0											
94	Command directional effective level	<p>Set as:</p> <p>0: High level positive direction;</p> <p>1: Low level positive direction.</p>	0-1	0											
95	Motor encoder resolution	<p>Encoder resolution, default to 2 of the 17 times square - 131072, set the value of 17, please modify carefully, otherwise the wrong setting will lead to flying cars.</p>	10-32	17											
96	Number of motor pole pairs	<p>This FArparameter represents the motor pole pair. Please modify it carefully, otherwise the wrong setting will cause the flying car.</p>	1-360	5											
97	Motor zero offset angle	<p>The zero-bit bias angle of the encoder and the motor is determined by the motor.</p>	0-3600	216											
99	Maximum duty cycle position ring when braking	<p>Maximum duty ratio setting when braking.</p>	5-90	50											

Chapter7

Seq	name	Function	FAra.range	default
100	Filterselect on position loop	Setto: 0: Digital moving averagefilter; 1: Exponential smoothingfilter.	0-1	0
101	Position loop feedforwar dgain	Feed forward reduces the position tracking error when positioncontrol is set to 100, and theposition tracking error is always 0 underthe command pulse at anyfrequency.	0-100	0
102	Positionlo op feedforwar d filter time constant	Position ring feed filtering toincrease the stability of thefeed-forward control.	20-500	100
103	Z Signal Output Pulse Width	Z Signal Output Pulse Width.	1-200	50
104	RS Output Function Selection	To set: 0: It can use RS485communication function. 1: No RS485 communicationfunction, but it can add aprogrammable output port which can outputdifferential signal(Z signal asdefault).	0-1	0
108	多圈信息错 误报警检测	设置为: 0: 启用多圈信息错误报警检测。 1: 屏蔽多圈信息错误报警检测。	0-1	0
111	电压泄放及 过压处理机 制等级	修改参数为非 0 值，需要接入合适的外置刹车电阻。随着数字递增压报警灵敏度降低，5 为屏蔽过压报警。	0-5	0
112	母线电压建 立完成延时	设置母线电压建立完成的等待延时，适当增大参数有利于能量的充分充能再让伺服进入符合使能的状态。	0-5000 ms	0
113	AC 欠压立 即失能	设置为: 0: 关闭 AC 欠压立即关闭使能。 1: 启用 AC 欠压立即关闭使能。	0-1	0
114	关闭继电器 的 延时	设置动态制动关闭继电器的延时时间。	5-3000 ms	10

Seq	name	Function	FAra.range	default
115	电压合法无故障失能是否关闭继电器	无报警条件下, 伺服关闭使能的继电器动作处理 0: 不关闭继电器。 1: 关闭继电器。	0-1	0
117	动力线断开报警的指令力矩阈值(额定力矩的百分比)	指令力矩大于该阈值作为动力线断开报警的判定条件之一。增大参数可降低报警检测的灵敏度, 减小则提升报警检测的灵敏度。	50-300%	80
118	动力线断开报警的反馈力矩阈值(额定力矩的百分比)	反馈力矩小于该阈值作为动力线断开报警的判定条件之一。减小参数可降低报警检测的灵敏度, 增大则提升报警检测的灵敏度。	0-300%	35
119	动力线断开报警的速度阈值(额定转速的百分比)	当前速度小于该阈值作为动力线断开报警的判定条件之一。	1-100%	25
120	动力线断开的报警时间	参数 FA117,FA118 和 FA119 对应阈值满足条件的。设置为 0 可屏蔽动力线断开报警检测。	0-30000 ms	8
121	驱动器断电时快速掉电	驱动器在无报警状态下断电, 0: 不启用快速掉电。 1: 启用快速掉电。	0-1	0

7.2 FC Group FParameters For Multifunctional Terminals

7.2.1 FParameterTable

Q series servo drives have 4 input terminals and 4 output terminals. The definition values can be set by FC group FParameters.(Low level is effective as default for input terminals).

FParameter	Name	Range	Factory value
FC-0	Digital input DI1 function	0-99	1
FC-1	Digital input DI2 function	0-99	2
FC-2	Digital input DI3 function	0-99	3

FParameter	Name	Range	Factory value
FC-3	Digital input DI4 function	0-99	4
FC-15	Digital input DI forced effective1	00000000-11111111	00000000
FC-16	Digital input DI forced effective2	00000000-11111111	00000000
FC-17	Digital input DI forced effective3	00000000-11111111	00000000
FC-18	Digital input DI forced effective4	00000000-11111111	00000000
FC-19	Digital input DI forced effective5	00000000-11111111	00000000
FC-20	Digital output DO1 function	0-99	2
FC-21	Digital output DO1 function	0-99	3
FC-22	Digital output DO1 function	0-99	5
FC-23	Digital output DO1 function	0-99	8
FC-30	Virtual input terminalcontrol	0-2	0
FC-31	Virtual input terminalstatus value	00000000-11111111	00000000
FC-32	Virtual output terminalcontrol	0-1	0
FC-33	Virtual output terminalstatus value	0000-1111	0000
FC-23	Virtual IO input DI1function	0-99	5
FC-38	Virtual IO input DI2function	0-99	6
FC-39	Virtual IO input DI3function	0-99	7
FC-40	Virtual IO input DI4function	0-99	8
FC-41	Virtual IO input DI5function	0-99	9
FC-42	Virtual IO input DI6function	0-99	10
FC-43	Virtual IO input DI6function	0-99	11
FC-44	Virtual IO input DI7function	0-99	11
FC-45	Virtual IO input DI8function	0-99	12

NOTE:

- 1: When FC-30 is 0, the IO input is determined by DI1 to DI4 to enter the number of IOs for 4, corresponding to the FParameter FC-0 to FC-3;
- 2: FC-30 \leq 1, IO input by the virtual IOFC-31 corresponding bits to determine the number of input IOs for 8, corresponding FParameters FC-38 to FC-45;
- 3: FC-30=2, the IO input is determined by DI1 to DI4 and FC-31, the number of IOs is 12, corresponding to FParameters FC-0 to FC-3 and FC-38 to FC-45.

7.2.2 DI Function Explanation

The input terminals (four terminals correspond to FC group FParameters are FC-0, FC-1, FC-2, FC-3) define the values.

Define the value	Symbol	Function	Functional resolution
0	NULL	No function	The input status has no effect on the system.
1	SON	Servo enablement	The servo enables the input terminals. OFF: Servo driver can not be used, the motor does not current; ON: Servo driver enables the motor to switch on current.
2	ARST	Alarm cleared	Alarm clear input terminal: When there is an alarm, if the alarm allow to clear, enter the rising edge (OFF changes ON moments) to clear the alarm. Note: Only some alarms are allowed to clear.
3	CCWL	Forward drive prohibited	1. CCW drive prohibited input terminal: OFF: Prohibit forward rotation (CCW) rotation; ON: Allow forward rotation (CCW) rotation. Used for mechanical limit travel protection, the function is controlled by FParameter FA-20. Note that the default value of FA-20 ignores this function. If you need to enable this function, you need to modify FA-20: 1. When FA-20 is 0, the function of input prohibition is valid, and whether CCW is prohibited is controlled by FA-83; 2. When FA-20 is 1, the input prohibition function is invalid, and whether CCW prohibition is not controlled by FA-83. 3. When the prohibition function is valid (FA-20 is 0): 1. When FA-83 is 0, the forward torque is limited to 0, and the forward pulse input is not limited; When FA-83 is 1, the input of forward pulse is prohibited.
4	CWL	Reverse drive prohibition	1. CW drive prohibited input terminal: OFF: Prohibit forward rotation (CW) rotation; ON: Allow forward rotation (CW) rotation. 2. Used for mechanical limit travel protection, the

Chapter7

			<p>function is controlled by FArparameterFA-20. Note that the default value of FA-20 is to ignore this function, if you need to enable this function, you need to modify FA-20:</p> <p>A: When FA-20 is 0, the function of input prohibition is valid, and whether CW is prohibited is controlled by FA-83;</p> <p>B: When FA-20 is 1, the function of input prohibition is invalid, and whether CW is prohibited is not controlled by FA-83.</p> <p>3. When the prohibition function is valid (FA-20 is 0):</p> <p>A: When FA-83 is 0, the reverse torque is limited to 0, and the reverse pulse input is not limited;</p> <p>B: When FA-83 is 1, the input of reverse pulse is prohibited.</p>
5	TCCW	Forward torque limit	<p>OFF: CCW direction torque is not limited by FA-36 FArparameter;</p> <p>ON: The torque in the CCW direction is limited by the FA-36 FArparameter.</p> <p>Note: Regardless of whether TCCW is valid or invalid, the torque in the CCW direction is still limited by FArparameterFA-34.</p>
6	TCW	Reverse torque limit	<p>OFF: CW direction torque is not limited by FA-37 FArparameter;</p> <p>ON: CW direction torque is limited by FA-37 FArparameter.</p> <p>Note: No matter whether TCW is valid or invalid, the torque in CW direction is still limited by FArparameterFA-35.</p>
7	ZCLAMP	Zero speed clamp	<p>When the following conditions are met, the zero-speed clamp function is turned on (the speed is forced to zero):</p> <p>Condition 1: Speed control mode (FA4=1), when external speed is selected (FA22=0);</p> <p>Condition 2: ZCLAMPON;</p> <p>Condition 3: The speed command is lower than the FArparameterFA-75.</p> <p>When any of the above conditions are not met, normal speed control is executed.</p>
8	CZERO	Zero instruction	<p>Under speed or torque control, the speed or torque commands are respectively:</p> <p>OFF: normal command; ON: Zero command.</p>

Chapter7

9	CINV	Inverted instruction	Under speed or torque control, the speed or torque commands are respectively: OFF: normal command; ON: The command is reversed.
10	SP1	Speed selection 1	Under speed control (FA4-1), when selecting the internal speed (FA22=1), SP1 and SP2 are combined to select different internal speeds: SP2-OFF SP1-OFF: Internal Speed 1 (FA parameter FA-24) SP2-OFF SP1-ON: Internal Speed 2 (FA parameter FA-25) SP2-ON SP1-OFF: Internal Speed 3 (FA parameter FA-26) SP2-ON SP1-ON: Internal Speed 4 (FA parameter FA-27)
11	SP2	Speed selection 2	
13	TRQ1	Torque selection 1	Under torque control mode (FA4-2), when selecting the internal torque (FA32-1), the TRQ1, TRQ2 combination selects different internal torques: TRQ2-OFF TRQ1-OFF: Internal Torque 1 (FA parameter FA-64) TRQ2-OFF TRQ1-ON: Internal Torque 2 (FA parameter FA-65) TRQ2-ON TRQ1-OFF: Internal Torque 3 (FA parameter FA-66) TRQ2-ON TRQ1-ON: Internal Torque 4 (FA parameter FA-67)
14	TRQ2	Torque selection 2	
16	CMODE	Multi-mode control mode setting	When the FA-4 is set to 3, 4, 5, it is in mixed control mode, which allows you to switch control modes through this input terminal: (1) When FA-4 is 3, CMODE OFF is position mode, and CMODE ON is speed mode; (2) When FA-4 is 4, CMODE OFF is position mode and CMODE ON is torque mode; (3) When the FA-4 is 5, CMODE OFF is speed mode and CMODE ON is torque mode.
18	GEAR1	Electronic gear selection 1	When FA-11 is 0, the combination of GEAR1 and GEAR2 is used to select the numerator of different electronic gear ratios: GEAR2=OFF GEAR1=OFF: numerator 1 (FA parameter FA-12) GEAR2=OFF GEAR1=ON: numerator 2 (FA parameter FA-77)

Chapter7

			<p>GEAR2=ON GEAR1= OFF: numerator3 (FAparameterFA-78)</p> <p>GEAR2=ON GEAR1=ON: numerator4 (FAparameterFA-79)</p>
19	GEAR2	Electronic gear selection 2	
20	CLR	Position deviation clear	In position control mode, the position deviation counter zeros the input terminals.
21	INH	Pulse input prohibited	In position control mode, the position command pulse prohibit terminals: OFF: the command pulse input is valid; ON: The command pulse input is prohibited.
22	JOGP	Positive inching	In speed mode, when FA22 is 5, the signal is switched on, the motor is moving in the positive direction, and the speed is set by FA21. Note: This signal is switched on at the same time as the reverse inch motion, and the inch action function is not valid.
23	JOGN	Reverse Inching	In speed mode, and FA22 is 5, this signal is switched on, the motor is moving in the opposite direction, and the speed is set by FA21. Note: This signal is switched on at the same time as the forward inch movement, and the inch movement function is not valid.
27	HOLD	Internal position control command stop	When the internal position register mode is on, the signal is switched on and the motor will stop running (only in the internal position mode FA-14-3).
28	CTRG	Internal position command trigger	In the internal position register mode, when the internal position register control command (POS0-2) is selected, the signal is triggered and the motor operates according to the internal position register command. The next trigger internal position command is accepted when the digital output of a zero speed signal (ZSPD=1).

29	POS0	Internal position command selection 0	<p>Corresponding relationship of internal location selection:</p> <table border="1"> <thead> <tr> <th>location command</th> <th>POS2</th> <th>POS1</th> <th>POS0</th> <th>CTRG</th> <th>corresponding parameter</th> </tr> </thead> <tbody> <tr> <td>P1</td> <td>0</td> <td>0</td> <td>0</td> <td>↑</td> <td>P4-2 P4-3</td> </tr> <tr> <td>P2</td> <td>0</td> <td>0</td> <td>1</td> <td>↑</td> <td>P4-5 P4-6</td> </tr> <tr> <td>P3</td> <td>0</td> <td>1</td> <td>0</td> <td>↑</td> <td>P4-8 P4-9</td> </tr> <tr> <td>P4</td> <td>0</td> <td>1</td> <td>1</td> <td>↑</td> <td>P4-11 P4-12</td> </tr> <tr> <td>P5</td> <td>1</td> <td>0</td> <td>0</td> <td>↑</td> <td>P4-14 P4-15</td> </tr> <tr> <td>P6</td> <td>1</td> <td>0</td> <td>1</td> <td>↑</td> <td>P4-17 P4-18</td> </tr> <tr> <td>P7</td> <td>1</td> <td>1</td> <td>0</td> <td>↑</td> <td>P4-20 P4-21</td> </tr> <tr> <td>P8</td> <td>1</td> <td>1</td> <td>1</td> <td>↑</td> <td>P4-23 P4-24</td> </tr> </tbody> </table>	location command	POS2	POS1	POS0	CTRG	corresponding parameter	P1	0	0	0	↑	P4-2 P4-3	P2	0	0	1	↑	P4-5 P4-6	P3	0	1	0	↑	P4-8 P4-9	P4	0	1	1	↑	P4-11 P4-12	P5	1	0	0	↑	P4-14 P4-15	P6	1	0	1	↑	P4-17 P4-18	P7	1	1	0	↑	P4-20 P4-21	P8	1	1	1	↑	P4-23 P4-24
location command	POS2	POS1		POS0	CTRG	corresponding parameter																																																			
P1	0	0		0	↑	P4-2 P4-3																																																			
P2	0	0		1	↑	P4-5 P4-6																																																			
P3	0	1	0	↑	P4-8 P4-9																																																				
P4	0	1	1	↑	P4-11 P4-12																																																				
P5	1	0	0	↑	P4-14 P4-15																																																				
P6	1	0	1	↑	P4-17 P4-18																																																				
P7	1	1	0	↑	P4-20 P4-21																																																				
P8	1	1	1	↑	P4-23 P4-24																																																				
30	POS1	Internal position command selection 1																																																							
31	POS2	Internal position command selection 2																																																							
33	SHOM	Starthome return	In internal position register mode, the origin needs to be searched and the search origin function is activated when this signal is switched on (refer to the settings of FD-34).																																																						
34	ORGP	Return to the origin	In internal position register mode, when searching for the origin, the servo takes the location of this point as the origin when the signal is switched on (refer to the setting of FParameter FD-32).																																																						

7.2.3DO Function Explanation

Definition values of output terminals (4 terminals corresponding to FC group FParameters are FC-20, FC-21, FC-22, FC-23):

Define the value	Symbol	Function	Functional resolution
1	ON	Always effective	Force output ON.
2	RDY	Servoready	OFF: Servo main power supply is not closed or has an alarm; ON: Servo main power supply is OK, no alarm.
3	ALM	Call the police	OFF: Alarms; ON: No alarm.
4	ZSP	Zerospeed	Speed and torque control, OFF: Motor speed is higher than FParameter FA-75 (regardless of direction); ON: The motor speed is lower than the

Chapter7

			FParameter FA-75 (regardless of direction).
5	COIN	Positioning completed	When position control is in place, OFF: The position deviation is greater than the FParameter FA-16; ON: The position deviation is less than the FParameter FA-16.
6	ASP	Speed reached	Speed and torque control, OFF: Motor speed is lower than FParameter FA-28; ON: The motor speed is higher than the FParameter FA-28. With polarity setting function, refer to the description of FParameter FA-28.
7	ATRQ	Torque reached	OFF: The motor torque is lower than the FParameter FA-89; ON: The motor torque is higher than the FParameter FA-89. With polarity settings, refer to the description of FParameter FA-89.
8	BRK	Electromagnetic brake	OFF: electromagnetic brake; ON: Electromagnetic brake release.
9	RUN	Servo running	OFF: Servo motor is not powered on; ON: The servo motor is powered on.
10	NEAR	Positioning close	When position control is in place, OFF: The position deviation is greater than the FParameter FA-85; ON: Position deviation small residual FParameter FA-85.
11	TRQL	Torque limit	OFF: the motor torque does not reach the limit value; ON: The motor torque reaches the limit. The torque limit method is set by FParameters FA-34, FA-35, FA-36, FA-37.
12	SPL	Speed limit	When torque is controlled, OFF: the motor speed does not reach the limit value; ON: Motor speed reaches the limit. The speed limit method is set by FParameter FA-50.
13	VCOIN	Consistent speed	OFF: The absolute value of the difference between the actual speed and the command speed is greater than FA76; ON: The absolute difference between the actual speed and the command speed is less than FA76.
15	HOME	Return to origin completed	OFF: No signal is output when origin regression is not completed; ON: Signal output when origin regression is complete.
16	CMDOK	Internal position command	OFF: Do not output a signal when the internal position command is not completed or the internal location command is not stopped;

		completed	ON: When the internal position command is complete or the internal position command is stopped, the signal is output after FD-1set time.
18	ZOUT	Z signal output	OFF: When the Z signal is invalid, no signal is output; ON : When the Z signal is valid, the signal is output.

DI7.2.4 DI Forced Valid

(1) There are five FParameters in the FC group (FC-15, FC-16, FC-17, FC-18, FC-19) that can be set to be digital input DI forced valid. There are five FParameters in the FC group (FC-15, FC-16, FC-17, FC-18, FC-19) that can be set to be digital input DI forced valid.

Digit	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
Function	CZERO	ZCLAMP	TCW	TCCW	CWL	CCWL	ARST	SON

(2) The corresponding function of FC-16 is represented by 8-bit binary::

Digit	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
Function	CMODE	NULL	TRQ2	TRQ1	NULL	SP2	SP1	CINV

(3) The corresponding function of FC-17 is represented by 8-bit binary:

Digit	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
Function	NULL	JOGN	JOGP	INH	CLR	GEAR2	GEAR1	NULL

(4) The corresponding function of FC-18 is represented by 8-bit binary::

Digit	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
Function	NULL	POS2	POS1	POS0	CTRG	HOLD	NULL	NULL

(5) The corresponding function of FC-19 is represented by 8-bit binary:

Digit	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
Function	NULL	NULL	NULL	NULL	NULL	NULL	ORGP	SHOM

FParameter meaning::

Any one of the 5 FParameters	Corresponding function	Function Results
0	Not planned	OFF (invalid)
	Planned	Up to Signal

1	Not planned or Planned	ON (Enforcement works)
---	------------------------	------------------------



◆ Planned means that the FArparameter has been selected by the input terminal in FC-0~FC-3, and the opposite is true if it is not planned.

7.3 FD Group FArparameters For Internal Position Command

Serial number	Name	Function	Arparameter range	Factory value
FD-0	Internal position command control mode	0: Absolute positioncommand; 1: Incremental position command.	0-1	0
FD-1	Internal position command completion digital output delay	1. When the internal position command is completed or the internal position command is stopped, after the delay time set in FD-1, the internal position command complete (CMDOK) DO signal is output. 2. When the FD-1 delay time is set to 0, when the DO signal zero speed detection (ZSPD) is set to 1, the internal position command of the trigger signal is accepted again. 3. When the FD-1 delay time is not set to 0, it is set to 1 when the internal position command of the DO signal is completed (CMDOK), and then the internal position command triggered by the DI signal command trigger (CTRG) is accepted.	0-200ms	0
FD-2	Setting of position circle number of internal position command 1	Sets the number of positional laps for the internal position of FAragraph 1.	-30000-30000	0

Chapter7

Serial number	Name	Function	Parameter range	Factory value
FD-3	Setting of the number of pulses in the position circle of the internal position command 1	1. Set the number of position pulses for the internal position of the first segment. 2. The internal position command 1 = the set value of the number of turns of the internal position of the first stage + the set value of the number of pulses of the internal position of the first stage. (Max is the set number of pulses per revolution of the motor, please refer to the setting of FA-11, FA-12, and FA-13).	+/- max.cnt/ rev	0
FD-4	Movement speed setting of internal position command control 1	Set the internal position command to control the speed of movement of 1.	0-5000 r/min	1000
FD-5	Setting of position circle number of internal position command 2	Sets the number of positional laps in the internal position of Paragraph 2.	-30000- 30000	0
FD-6	Setting of the number of pulses in the position circle of the internal position command 2	Set the number of position pulses for the internal position of the second segment. The internal position command 2 = the set value of the number of turns of the internal position of the second stage + the set value of the number of pulses of the internal position of the second stage.	+/- max.cnt/ rev	0
FD-7	Movement speed setting of internal position command control 2	Set the internal position command to control the speed of movement of 2.	0-5000 r/min	1000
FD-8	Setting of position circle number of internal position command 3	Set the number of positional laps for the internal position of Paragraph 3.	-30000- 30000	0
FD-9	Setting of the number of pulses	Set the number of position pulses for the internal position of the third	+/- max.cnt/ rev	0

Chapter7

Serial number	Name	Function	Aparameter range	Factory value
	in the position circle of the internal position command 3	segment.	rev	
FD-9	Setting of the number of pulses in the position circle of the internal position command 3	The internal position command 3= the set value of the number of turns of the internal position of the third stage + the set value of the number of pulses of the internal position of the third stage.	+/- max.cnt/ rev	0
FD-10	Movement speed setting of internal position command control 3	Set the internal position command to control the movement speed of 3.	0-5000 r/min	1000
FD-11	Setting of position circle number of internal position command 4	Sets the number of position laps in the internal position of FAragraph 4.	-30000- 30000	0
FD-12	Setting of the number of pulses in the position circle of the internal position command 4	Sets the number of position pulses at the internal position of segment 4. Internal position instruction 4 -The internal positional number of revolutions in FAragraph 4 is set and the internal position pulse setting in FAragraph 4 is set.	+/- max.cnt/ rev	0
FD-13	Movement speed setting of internal position command control 4	Set the movement speed of the internal position command control 4.	0-5000 r/min	1000
FD-14	Setting of position circle number of internal position command 5	Set the number of positional laps for the internal position of FAragraph 5.	-30000- 30000	0
FD-15	Setting of the number of pulses	Sets the number of position pulses at the internal position of segment 5.	+/- max.cnt/ rev	0


Chapter7

Serial number	Name	Function	Aparameter range	Factory value
	in the position circle of the internal position command 5	Internal position instruction 5 -The internal positional number of revolutions in the 5th FAgraph is set.	rev	
FD-16	Internal position command control 5 movement speed setting	Set the internal position command to control the speed of movement of 5.	0-5000 r/min	1000
FD-17	Setting of position circle number of internal position command 6	Sets the number of positional laps for the internal position of FAgraph 6.	-30000-30000	0
FD-18	Setting the number of pulses in the position circle of internal position command 6	Sets the number of position pulses at the internal position of segment 6. Internal position instruction 6 -The internal positional number set value of FAgraph 6 and the internal position pulse setting value of FAgraph 6.	+/- max.cnt/rev	0
FD-19	Internal position command control 6 movement speed setting	Set the internal position command to control the movement speed of 6.	0-5000 r/min	1000
FD-20	Setting of position circle number of internal position command 7	Sets the number of position laps for the internal position of FAgraph 7.	-30000-30000	0
FD-21	The number of pulses in the position circle of the internal position command 7 is set	Sets the number of position pulses at the internal position of segment 7. Internal position instruction 7 -The internal position number set value of FAgraph 7 and the internal position pulse setting value of FAgraph 7.	+/- max.cnt/rev	0
FD-22	Internal position command control 7 movement speed setting	Set the internal position command to control the speed of movement of 7.	0-5000 r/min	1000
FD-23	Setting of	Sets the number of positional laps for	-30000-	0

Chapter7

Serial number	Name	Function	Parameter range	Factory value
	position circle number of internal position command 8	the internal position of FAgraph 8.	30000	
FD-24	Setting of pulse number in position circle of internal position command 8	Sets the number of position pulses at the internal position of FAgraph 8. Internal Position Directive 8 -The internal positional number of revolutions in FAgraph 8 is set , and the internal position pulse setting in FAgraph 8 is set.	+/- max.cnt/ rev	0
FD-25	Internal position command control 8 moving speed setting	Set the internal position command to control the speed of movement of 8.	0-5000 r/min	1000
FD-32	Origin detector type and search direction setting	0: forward direction origin regression, CCWL as regressionorigin; 1: Reverse direction origin regression, CWL as regressionorigin; 2: Forward direction origin regression, ORGP as regressionorigin; 3: Reverse direction origin regression, ORGP as regressionorigin; 4: turn directly to find the absolute position of the single circle zero point for the regression origin; 5: Reverse directly looking for the absolute position zero of the lap is the regression origin.	0-5	0
FD-33	Short-distance movement method setting to reach the origin	0: After finding the reference origin,return to find the single-turn absolute position zero point as the mechanical origin; 1: Do not return after finding the reference origin, look forward to the absolute position zero point of a single circle as the mechanical origin; 2: After finding the referenceorigin (ORGP rising edge or single-turnabsolute	0-2	0

Chapter7

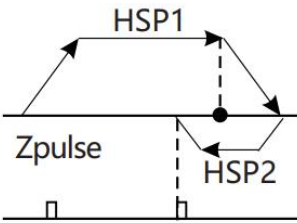Serial number	Name	Function	Parameter range	Factory value
		position zero point) as the mechanical origin, decelerate to a stop.		
FD-34	Origin trigger start mode	0: Turn off origin regression; 1: When the power is on, the origin regression function is automatically performed; 2: Trigger origin regression by the origin search function (SHOM) input contact.	0-2	0
FD-35	Origin stop mode setting	0: After the origin detection is completed, the motor slows down and pulls back to the origin; 1: After the origin detection is complete, the motor slows down in the forward direction and stops.	0-1	0
FD-36	The first stage of high-speed home return speed setting (HSPD1)	Set the first high-speed origin regression speed. 	1-2000 r/min	1000
FD-37	The second stage of low-speed home return speed setting (HSPD2)	Set the second low-speed origin regression speed.	1-500 r/min	50
FD-38	Home return offset circle number (HOF1)	Sets the number of origin regression offset circles.	-30000-30000	0
FD-39	Origin return offset pulse number (HOF2)	1.Sets the number of origin regression offset pulses. 2.When the FArparameter function HOF1, HOF2 is set to zero, the origin is defined as the absolute position zero or ORGP of the single circle according to the origin regression mode. If the set value is not zero, the origin will be based on the above-mentioned	+/- max.cnt/ rev	0

Chapter7

Serial number	Name	Function	Parameter range	Factory value
		singlecircle absolute position zero or ORGP plus a pulse offset HOF1 x 10000 plus HOF2 as the new origin.		

Chapter 8 Error Code

Fault symbol	Fault name	Fault content
-	normal	
1	Speeding	Servo motor speed exceeds the set value
2	Main circuit overvoltage	The main circuit power supply voltage is too high
3	Main circuit undervoltage	The main circuit power supply voltage is too low
4	Location is out of tolerance	The value of the position deviation counter exceeds the set value
5	Drive overheating	Drive temperature is too high
6	Speed amplifier saturation failure	Speed regulation is saturated for a long time
7	Drive prohibited exception	CCW/CW drive prohibition inputs are all OFF
8	Position deviation counter overflow	The absolute value of the position deviation count exceeds 230
11	IPM module failure	IPM smart module failure
13	Drive overload	Servo drive and motor overload (instantaneous overheating)
14	Brake failure	Brake circuit failure
18	Relay switch failure	The actual state of the relay is inconsistent with the control state
19	Brake delay error	Pulse input when the brake is not open
20	EEPROM error	EEPROM error
21	FPGA module failure	Abnormal function of FPGA module
23	Current acquisition circuit failure	Current acquisition circuit failure
29	User torque overload alarm	The motor load exceeds the value and duration set by the user
42	AC input voltage is too low	AC input voltage is too low
47	The main circuit voltage is too high when powering on	The main circuit voltage is too high when powering on
50	Encoder communication failure	The drive and the encoder have not established a communication connection

Chapter8

Fault symbol	Fault name	Fault content
51	Encoder communication abnormal	After the encoder communication is established, the communication is interrupted and the connection is disconnected
52	Encoder battery voltage is low alarm	Encoder battery voltage is low and alarm, the information is not lost but needs to be replaced as soon as possible
53	Encoder battery voltage error alarm	Encoder battery voltage error alarm, the stored information has been wrong, the encoder needs to be reset
54	Encoder error alarm	Encoder is not battery alarm, but the encoder needs to be reset
55	CRC check error 3 times in a row	The CRC of the data received by the encoder communication has errors for 3 consecutive times
56	MODBUS frame too long error	The received MODBUS frame data is too long
57	MODBUS communication format is abnormal	Improper communication FArparameter setting or incorrect address or value
58	Wrong lap positionvalue	The single-turn position offset value stored bythe drive exceeds the encoder resolution
59	Encoder reports CF error	The encoder continuously reports errors in the CF domain, and the encoder needs to be reset

Chapter 9 Alarm handling method

alarm code	Name	Run State	Cause	Way to deal
1	Over speed	Appear when Power on	1. Control board failure. 2. Encoder failure.	1. Change the servo drive. 2. Change the servo motor.
		During Motor running	The input command pulse frequency is too high.	Set the input command pulse correctly.
			The acceleration/deceleration time constant is too small, making the speed overshoot too large.	Increase the acceleration/deceleration time constant.
			The input electronic gear ratio is too large.	Set it up correctly.
			Encoder failure.	Change the servo motor.
			Bad encoder cable.	Change the encoder cable.
			The servo system is unstable, causing overshoot.	1. Reset the gain value. 2. If the gain cannot be set to a suitable value, reduce the kinetic inertia ratio.
		When Motor start	Excessive load.	1. Reduce the amount of load. 2. Replace with a higher power drive and motor.
1. Encoder zero point error. 2. The motor UVW leads are connected incorrectly. 3. The encoder cable leads are connected incorrectly.	1. Change the servo motor. 2. Ask the manufacturer to readjust the encoder zero. 3. Correct wiring.„			
2	Main circuit overvoltage	Appears when the control power is turned on	Circuit board malfunction.	Replace the servo driver.

Chapter9

alarm code	Name	Run State	Cause	Way to deal
		Appears when the main power is turned on	<ol style="list-style-type: none"> 1. The power supply voltage is too high. 2. The power supply voltage waveform is abnormal. 	Check the power supply.
		During motor operation	The brake resistor wiring is disconnected.	Reconnection
			<ol style="list-style-type: none"> 1. The brake transistor is damaged. 2. The internal braking resistor is damaged. 	Replace the servo driver.
			Insufficient caFacity of the braking circuit.	<ol style="list-style-type: none"> 1. Reduce the start stop frequency. 2. Increase the acceleration and deceleration time constant. 3. Reduce the torque limit value. 4. Reduce load inertia. 5. Replace with a higher power driver and motor.
3	Main circuit undervoltage	Appears when the main power is turned on	<ol style="list-style-type: none"> 1. Circuit board malfunction. 2. The power fuse is damaged. 3. Soft start circuit malfunction. 4. The rectifier is damaged. 	Replace the servo driver.
			<ol style="list-style-type: none"> 1. The power supply voltage is low. 2. Temporary power outage for more than 20ms. 	Check the power supply.
		During motor operation	<ol style="list-style-type: none"> 1. Insufficient power caFacity. 2. Instantaneous power failure. 	Check the power supply.
			The radiator is overheating.	Check the load condition.
4		Appears when the control power is turned on	Circuit board failure.	Replace the servo driver.

Chapter9

alarm code	Name	Run State	Cause	Way to deal
	Position deviation	Connect the main power supply and control line & input pulse commands, but the motor does not rotate or reverse	1. Encoder zero point change. 2. Encoder malfunction.	1. Readjust the encoder zero point. 2. Replace the servo motor.
		During motor operation	The detection range for setting position deviation is small.	Increase the detection range of position deviation.
			The position proportional gain is too small.	Increase the gain value.
			Insufficient torque.	1. Check the torque limit value. 2. Reduce load capacity. 3. Replace with a higher power driver and motor.
			The command pulse frequency is too high.	Reduce frequency.
			Encoder zero point change.	Readjust the zero point of the encoder.
5	Drive overheating	During the operation of the drive	1. Circuit board malfunction. 2. The driver temperature is too high.	1. Reduce the temperature of the drive. 2. Replace the servo driver.
6	Speed amplification saturation fault	During motor operation	1. Excessive load. 2. The motor is mechanically stuck.	1. Reduce load. 2. Replace with a higher power driver and motor. 3. Check the mechanical FART of the load.

Chapter9

alarm code	Name	Run State	Cause	Way to deal
7	Drive inhibit abnormal		The CCW/CW drive inhibit input terminals are all disconnected.	Check the wiring.
8	Position deviation counter overflow		<ol style="list-style-type: none"> 1. The motor is mechanically stuck. 2. Abnormal input command pulse. 	<ol style="list-style-type: none"> 1. Check the mechanical FART of the load. 2. Check the command pulse. 3. Check whether the motor rotates in accordance with the command pulse.
11	IPM Module failure	Appear when the control power turns on	Circuit board failure.	Replace the servo driver.
		During motor operation	1. The power supply voltage is low. 2. Overheating.	<ol style="list-style-type: none"> 1. Check the drive. 2. Power on again. 3. Replace the drive.
			Short circuit in driver UVW	Check grounding line
			Poor grounding.	Grounding correctly
			The motor insulation is damaged.	Change motor
			Been interference	<ol style="list-style-type: none"> 1. Add line filters. 2. Stay away from interference sources.
13	Overload	Appears when the control power is turned on During motor operation	Circuit board failure.	Replace the servo driver.
			Operating exceed rated torque.	<ol style="list-style-type: none"> 1. Check the load. 2. Reduce the start stop frequency. 3. Reduce the torque limit value. 4. Replace the high-power driver and motor.
			Keep the brake not open.	Check and hold the brake.

Chapter9

alarm code	Name	Run State	Cause	Way to deal
			The motor oscillates, unstable.	1. Adjust the gain. 2. Increase acceleration/deceleration time. 3. Reduce load inertia.
			1. One phase of UVW is disconnected. 2. Encoder connection error.	Check wire connection
14	Braking fault		Brake circuit malfunction.	Replace drive
18	Relay switch failure		Relay damaged	Return to factory for reFAir.
19	Holding brake delay not opened		The FA94 FAparameter value is set too high, the control pulse has arrived, and the brake has not yet been opened.	Reduce FA94 value.
20	EEPROM error		Chip or circuit board broken.	1. Replace the servo driver. 2. After reFAir, you must reset the drive model (refer to FA10), and then restore the Default argument.
21	FPGA Module failure		FPGA Module function abnormal	Replace the driver
23	Current collection circuit fault		Current collection circuit fault.	Replace the driver
29	User torque overload alarm		1. The FAparameters of FA30 and FA31 are unreasonable. 2. Unexpected heavy load occurs.	1. Modify FAparameters. 2. ReFAir the machinery.

Chapter9

alarm code	Name	Run State	Cause	Way to deal
38	Reading and writing encoder EEPROM communication fail		1. The encoder cable is not properly connected 2. Encoder interface circuit failure	Check the wiring.
39	Data CRC verification ERROR		The motor encoder has not yet written data, all are 0.	Write the motor FArameters of the corresponding model into the encoder.
40	Model not supported		The drive does not support this motor model.	Use a matching motor.
41	Need to switch motor model		The current motor does not match the selected model of the drive.	Manually switch the model to the current model.
42	AC input voltage too low	When power off During Run	1. Normal. 2. The external AC voltage input is too low.	Check AC220V input
47	The main circuit voltage is too high when powered on		1. The external AC voltage input is too high. 2. Main circuit failure.	1. Check the AC220V input. 2. Replace the drive.
50	Encoder communication failure		The drive and encoder have not established a communication connection.	Connect the encoder cable and power it on again
51	Encoder communication error		After establishing communication with the encoder, there was an interruption and the connection was disconnected.	Connect the encoder cable and power it on again.

Chapter9

alarm code	Name	Run State	Cause	Way to deal
52	Encoder battery low voltage alarm		Encoder battery low voltage alarm, message not lost but needs to be replaced as soon as possible.	Replace the encoder battery.
53	Encoder battery voltage error alarm		Encoder battery voltage error alarm, stored information has been incorrect, encoder needs to be reset.	The encoder battery has been depleted and must be replaced.
54	Encoder error alarm		Encoder non battery alarm, but encoder needs to be reset.	Reset the encoder again.
55	CRC verification error 3 consecutive times		Data received through MODBUS communication CRC validation has experienced 3 consecutive errors	Replace the driver
56	MODBUSFrame too long error		<ol style="list-style-type: none"> 1. Communication protocol mismatch. 2. Affected by interference. 	<ol style="list-style-type: none"> 1. Confirm the frame length. 2. Add line filters to stay away from interference.
57	MODBUS Abnormal communication format		<ol style="list-style-type: none"> 1. Improper setting of communication FParameters. 2. The communication address or value is incorrect. 	Replace the driver
58	Single lap position value error		The single turn position offset value stored by the driver exceeds the encoder resolution.	Power on and start again
59	Encoder reported CF error		The encoder continuously reports CF domain errors and needs to be reset.	Reset the encoder again.

Small Size, High Precision

Qma

酷馬機電

臺灣酷馬機電股份有限公司

公司电话：00886-222029000 0573-8488222618968074627

技术支持：0573-8488222613817827870

公司传真：00886-222039000